

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q4 e-tron, and Q4 Sportback e-tron	2022 – 2024	All	Not applicable

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Condition</i> (Added model table) Revised <i>Service</i> (Updated procedure and part numbers)
1	12/03/2024	Initial publication

Customer statement:

A service call sometimes triggers itself without the customer touching the button.

Technical Background

The interior light module's touch performance is too sensitive.

Production Solution

Optimization of the touch function introduced in generation 06S of the interior light module.

Service



This TSB replaces Pending Service Solution (PSS) TSB 2071700: 91 PSS Service call is triggered on its own without driver input.

Check the part number of the interior light module (roof module) fitted in the vehicle.

1. If part number **89A.959.561.E** is fitted, replace it with part number **89A.959.569.A**.
2. If part number **89A.959.569.A** is already fitted, check the production label (Figure 1) on the interior light module to determine which generation is installed.

If the generation is **below** 06S, the interior light module (roof module) must be replaced.



Figure 1. Production label on interior light module with generation 03S.

Warranty

Claim Type:	<ul style="list-style-type: none"> If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9620		
Damage Code:	0040		
Labor Operations:	Remove and install interior light	9620 1900	See SRT with associated operations
	Replace interior light	9620 5550	See SRT with associated operations
	GFF	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2076201/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

All parts supplied by the parts department from now on will be generation 06S or higher.

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Roof module	01

Additional Information

All parts and service references provided in this TSB (**2076201**) are subject to change and/or removal.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.