

WSQ6 – Replacing USB/IPOD Control Unit (Workshop Campaign)

Model Line: **911 (992)**

Model Year: **2026**

Concerns: **USB/IPOD control unit**

Cause: **Due to a control error, USB/IPOD control unit was installed on the affected vehicles, on which Apple Car Play certification cannot be ensured and the quick charging function is not available.**

Action: Replace USB/IPOD control unit.

Affected Vehicles: Only the vehicles assigned to the campaign (see also PCSS Vehicle Information).

Required parts

The **part numbers** of the **required parts** for the respective vehicle can be seen in the **assigned scope**, see section "warranty processing".

Required tools

- Tools:
- **P90999 - Porsche Tester 4**
 - Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*
 - Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g. **V.A.G 1783 - torque wrench, 2-10 Nm (1.5-7.5 ftlb.)**
 - Torque wrench 6-50 Nm (4.5-37 ftlb.), e.g. **V.A.G 1331A - torque wrench 6-50 Nm (4.5-37 ftlb.)**

Replacing USB/IPOD control unit

- Work Procedure:
- 1 Replace previous USB/IPOD control unit with **new** USB/IPOD control unit.
For work procedure, see: ⇒ *Workshop Manual '919319A3 Removing and installing USB/IPOD control unit'*
 - 2 Read out and delete all control unit fault memories.
 - 3 Exit the diagnostic application, switch off the ignition and disconnect **P90999 - Porsche Tester 4** from the vehicle.

- 4 Switch off and disconnect the battery charger.
⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*
- 5 Enter the campaign in the warranty and maintenance logbook.

Warranty processing



Information

The stated labor time was determined specifically for carrying out this Campaign and includes all necessary preliminary work and rework. The labor time may differ from the labor times published in the Labor Operation List in PCSS.

Scope 1:

Replacing USB/IPOD control unit

Labor time:

Replacing USB/IPOD control unit	Labor time: 122 TU
---------------------------------	---------------------------

Includes:

- Removing and installing USB/IPOD control unit
- Remove and install center console (upper part)
- Removing and installing rear seat cushion
- Removing and installing rear belt lock
- Charge battery
- Connect and disconnect Porsche Tester
- Reading out and erasing fault memories

Required parts:

95C035736A BLK	Multimedia interface - black	1 piece
N 91026201	M10 hexagon collar nut	2 piece

⇒ **Damage number WSQ6 066 000 2**

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.