



# Service Bulletin

Bulletin No.: PIT6458

Date: December, 2025

## PRELIMINARY INFORMATION

**Subject:** Dead Battery Due To A Battery Draw

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025-2026		All	All	All	All
Chevrolet	Colorado	2023-2026		All	All	All	All
Chevrolet	Equinox	2025-2026		All	All	All	All
Chevrolet	Traverse	2024-2026		All	All	LK0	All
GMC	Acadia	2024-2026		All	All	All	All
GMC	Canyon	2023-2026		All	All	All	All
GMC	Terrain	2025-2026		All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	A vehicle may be towed in with a dead battery or a customer may complain of a no crank no start that required a jump start. Upon diagnosis an excessive battery draw may be found.
<b>Cause</b>	A coin may be lodged under one of the window switches in the driver/master window switch.

### Correction

Inspect the driver's window switch for a coin lodged under one of the buttons.

This will be visible and will not require any removal or disassembly of the window switch.

If a coin is found, remove the lodged coin.

Educate the customer of this condition and encourage them that coins should be stored away from the window switch.

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5481018*	Lodged Coin Removal- This is to be used in addition to diagnostic time, not instead of it.	0.2 Hr.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	12/04/2025 – Created on.

DRAFT

