

## **TECHNICAL SERVICE BULLETIN, VIN: WSB-06 Open Trail Rear Valve Stem Extenders**

December 8, 2025

Dear Tiffin Motorhome Owner,

It has come to our attention that on certain 2026 Open Trail Motorhomes, the rear inner tire has valve stem extenders installed that are not compatible with the tires on the motorhome. The current rear inner tire valve stem extenders do not allow air to pass into or out of the tire.

Tiffin Motorhomes will remove the current rear inner tire valve stem extenders and install a double seal flow through valves. Owners will need to utilize a long neck air chuck or flexible inflator to reach the inner tire.

Please take your motorhome to a service center of your choice to have the correction completed. This repair should take **30 minutes** or less and will be completed at no charge to you.

A list of Tiffin Motorhomes authorized dealers is available online at <https://tiffinmotorhomes.com/service-center-locations>. If you are using a service center that is not a Tiffin Motorhomes authorized repair facility, please make sure that they contact Tiffin Motorhomes at 256-356-0261 or [service@tiffinmotorhomes.com](mailto:service@tiffinmotorhomes.com) for the required instructions and time allowed for the repair. Tiffin Motorhomes will not pay over the allowed time unless the repair facility receives prior authorization. For authorization, contact Tiffin Motorhomes at 256-356-0261 or [service@tiffinmotorhomes.com](mailto:service@tiffinmotorhomes.com).

*This technical service bulletin will expire February 1, 2027. Please make sure that the repair is completed prior to this date. Work completed after this date will be done at the customer's expense.*

You may be liable for any progressive damage that results from your failure to complete this technical service bulletin within a reasonable time after receiving notification.

We regret any inconvenience this action may cause but feel certain you understand our interest in your continued use and enjoyment of your coach.

Tiffin Motorhomes

---

## Technical Service Bulletin WSB-06 Repair Instructions

**Purpose:** Remove and replace rear valve stem extensions

**Models:** 2025 & 2026 Open Trail Motorhomes

**FLAT RATE CODE & TIME ALLOWED** *To file the warranty claim for payment, please use the following flat rate code.*

**Inspected and repaired - 8906SB00 for 0.50 hours.**

**Inspected and not involved - 890GSB00 for 0.10 hours.**

**No authorization is required for work completed at the flat rate times stated on the work instructions. Use "WSB-06" as the authorization on claim for payment.**

Tools Needed:

Wheel chocks  
Valve core tool, if needed  
Air pressure gauge  
Tire Inflator  
Leak test solution  
10mm ratchet and socket set, if needed

Parts Needed:

2 of 5180975 - Valve Stem Short

Inspection Instructions:

1. Inspect the rear inner tire of the motorhome, if the 4-inch valve stem extenders are installed, follow the work instructions below. If the double seal flow through valve caps are already installed, no work needs to be done. File an inspection only claim to clear the TSB from the motorhome.

Work Instructions:

1. Verify the tire pressure in both the inner and outer tires for reference.
2. Hold the inner dual tire valve stem base firmly to prevent twisting or damage. Using your hand, unscrew the valve stem extension counterclockwise. If tight, use 10 mm socket to remove. Discard removed parts.
3. Install the new double seal flow through valve caps in place by turning clockwise and ensure it is tight.
4. Leak test valve core area by applying leak test solution around the valve core area. If any leaks are present, tighten or replace the valve core.
5. Re-check air pressure and adjust as needed.