



Service Bulletin

Bulletin No.: PIT6465

Date: December, 2025

PRELIMINARY INFORMATION

Subject: DRL LED Strip Flickering

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Tahoe	2026		November 19, 2025	EOP	All	All
Chevrolet	Suburban	2026		November 19, 2025	EOP	All	All
GMC	Yukon	2026		November 19, 2025	EOP	All	All
GMC	Yukon XL	2026		November 19, 2025	EOP	All	All

Involved Region or Country	North America
Condition	Note: This information only applies to vehicles build on or after November 19, 2025. A customer may comment that one or both headlight DRL LED strips, shown below, may intermittently flicker.
Cause	The cause of this condition may be the K219 Lighting Control Module.



DO NOT replace the headlamp assemblies for this condition.

7032454

After the concern is confirmed inspect the part number of the lighting control module in the vehicle. If the vehicle has one of the following p/n's: 13572175, 13572177, or 13572179, then replace the K219 Lighting Control Module with part number 13566314.

Parts Information

Description	Part Number	Qty
Lighting Control Module	13566314	1

Warranty Information

Labor Operation	Description	Labor Time
2081428*	Replaced Lighting Control Module	0.6 Hrs
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	12/11/2025 — Created.

