



STAR ONLINE PUBLICATION



Case Number: S2508000104

Release Date: December 2025

Symptom/Vehicle Issue: Blindspot, Automatic High Beams, Forward Collision Warning and Lane Management Inoperative

Customer Complaint/Technician Observation: The owner complains of the above warning systems that are not operating Technician observed the vehicle is setting Diagnostic Trouble Code (DTC) B178F-15 Stored or Active - Turn Signal Switch Circuit Short to Battery.

Repair Procedure: Vehicles that are setting DTC B178F-15 Turn Signal Switch Circuit should not replace the Body Control Module (BCM), the BCM is not a factor causing this fault. Follow the diagnostic test for B178F-15 and replace only the Steering Column Control Module (SCCM) if needed.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.