



CAN-AM ON-ROAD (3W) 2025-6 Canyon Rust on Saddle Bags Latches

Vehicle - Quality Bulletin

Can-Am On-Road

December 18, 2025
Bulletin 2025-6 | Version A
Campaign N° 2025-0006

Canyon Rust on Saddle Bags Latches

IMPORTANT

When receiving a vehicle for service:

- Always lookup the vehicle identification number (VIN) on the Knowledge Center to check for pending campaigns or alerts.
- Always connect the vehicle to the BRP diagnostic software (BUDS) to ensure all required updates are performed.
- Only vehicles displaying the symptoms outlined in this bulletin are eligible for repair. Claims on vehicles without these symptoms will be denied.

APPLICABILITY

MODEL YEAR	MODEL	ADMISSIBLE UNITS
MY25	Canyon XT and Redrock	In Knowledge Center: <ul style="list-style-type: none"> • Enter the VIN • Select the <i>DOCUMENTS AND ARTICLES</i> tab • Select filters: • Warranty in <i>ARTICLE TYPE CATEGORIES</i> • Warranty Bulletin in <i>ARTICLE TYPES</i>

PROBLEM

Latches were polluted at the supplier during the finish process, therefore the parts are not fully protected against moisture and tend to rust quickly.

SOLUTION

Remove the rust with the appropriate product, following the procedure established by BRP.

REQUIRED PARTS

No replacement part required.

You should have in your shop supply the following service product.

Service Product

DESCRIPTION	PART NUMBER	QTY
Ferronet rust remover	219800633	1

CORRECTIVE ACTION

The affected areas are, side case handles, top case handles, top case hinges.

1. Remove the top case and two saddle bags from vehicle.
2. Clean thoroughly and dry out.
3. Open latch to have access to the sides of the handle affected areas.
4. Use masking tape to protect the plastics, bare or painted aluminum surfaces.



CAUTION


Always wear gloves when manipulating chemical products.

- Using a small bristle paint brush and a small container, apply an even thin layer coat of the Ferronet rust remover on the affected area.



NOTICE


- Avoid using a foam paint brush as it will have a tendency to drip too much product.
- If some of the product gets spilled on the plastic or Aluminum surfaces, rinse immediately to avoid damage (white sections).

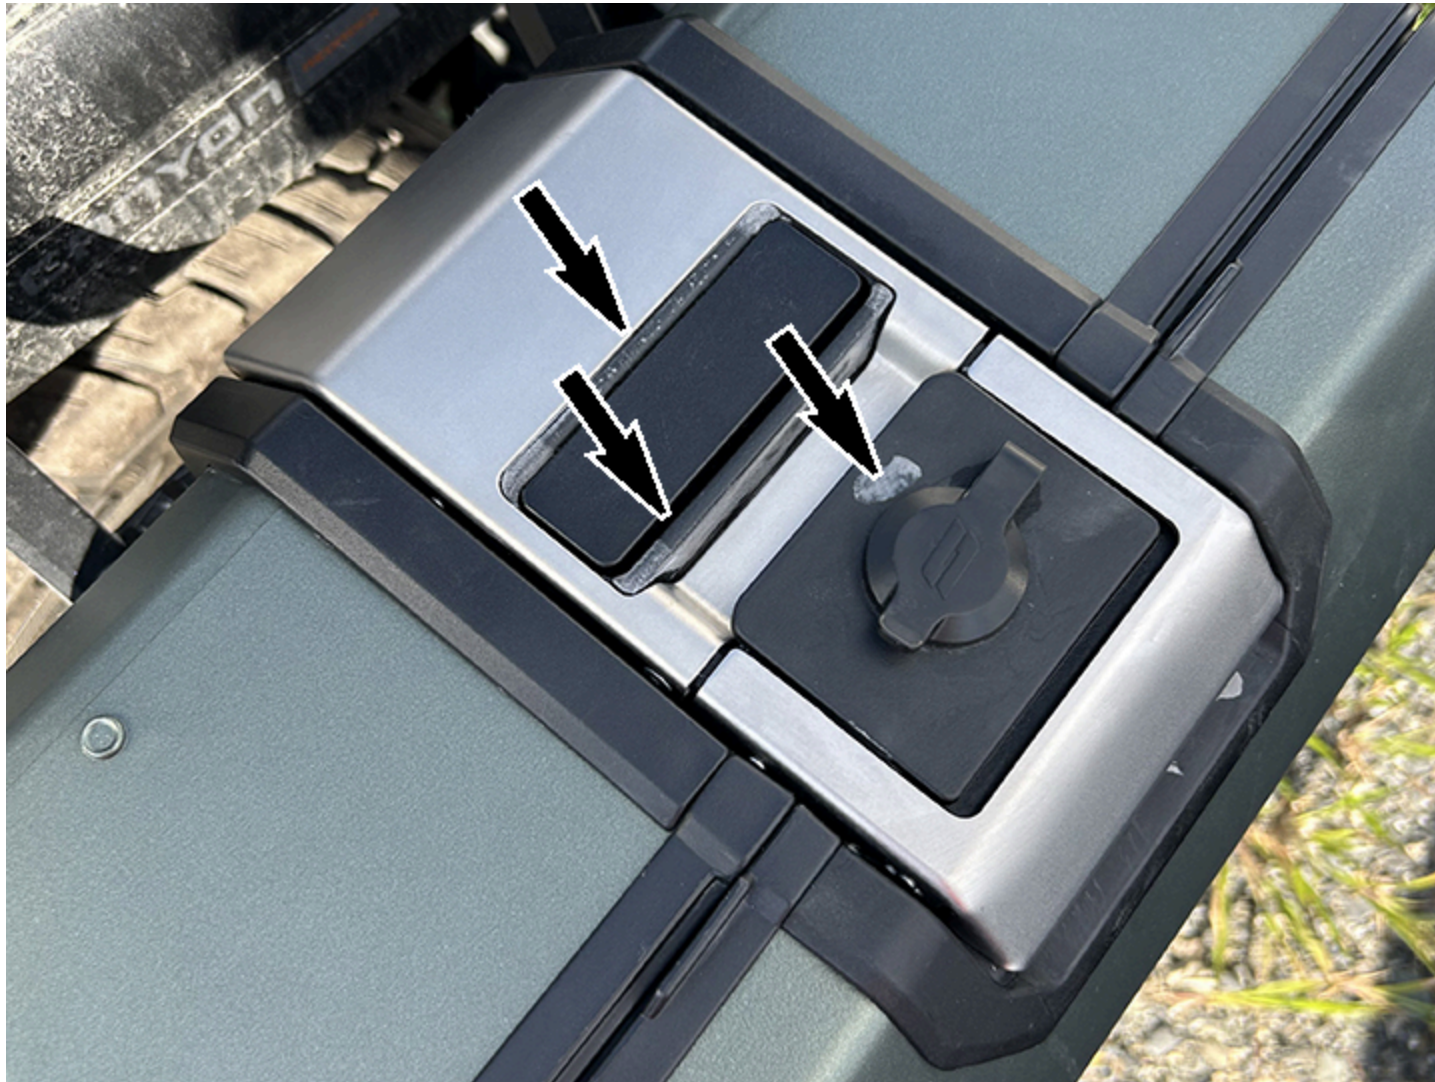

DAMAGED PLASTIC

6. Let the product work for 10 minutes *maximum*.
7. Then make sure to thoroughly rinse with plenty of water.
8. Remove masking tape and rinse again to avoid any Ferronet remaining.
9. Dry completely.

EXPECTED RESULT

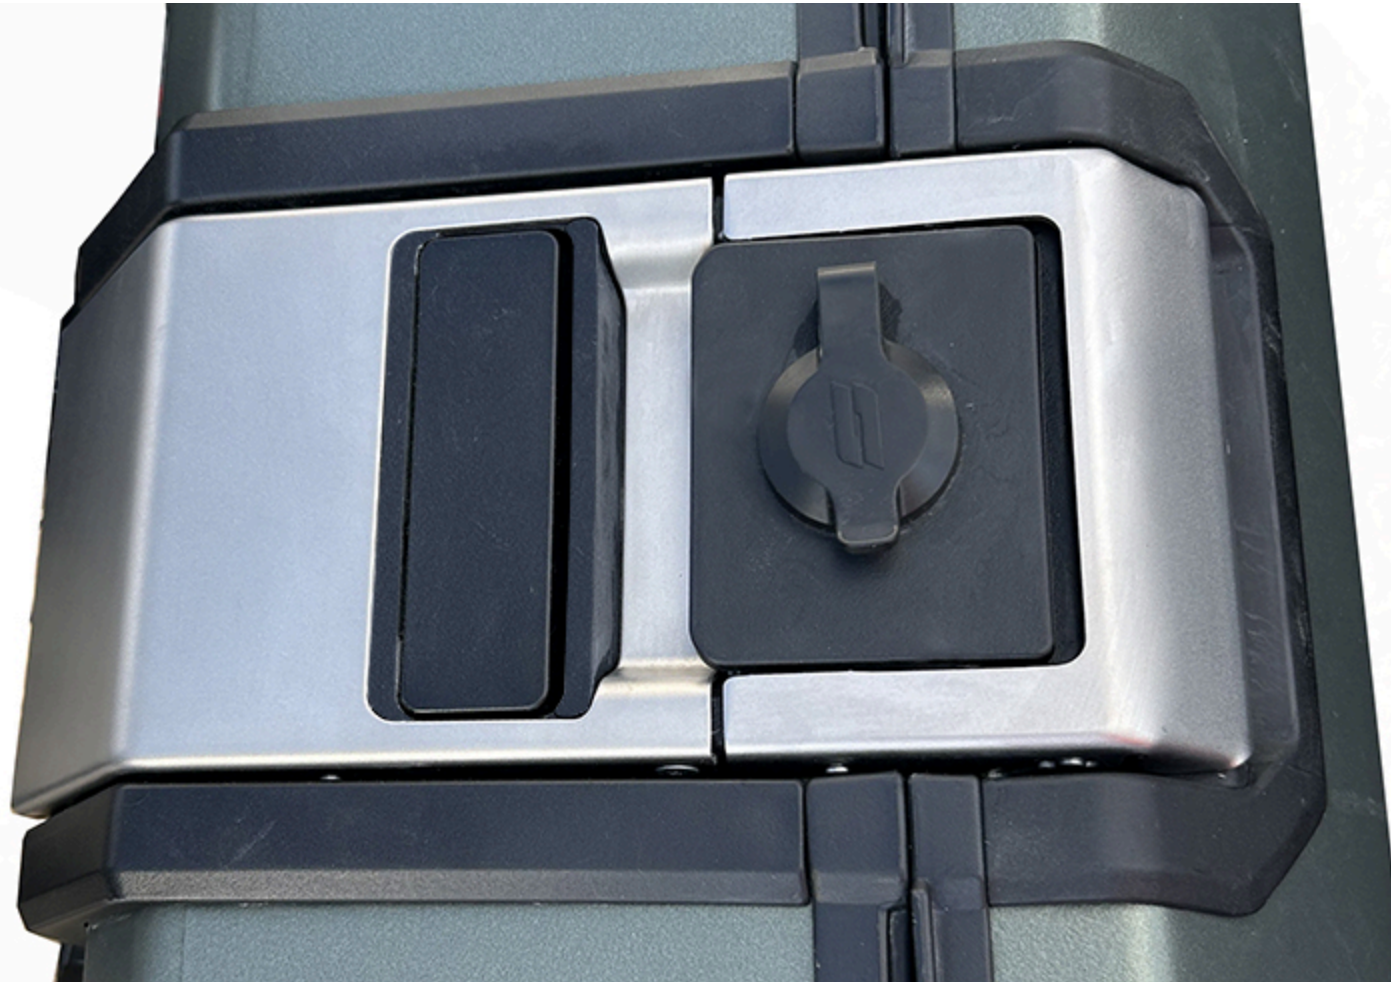



WARRANTY

Submit a warranty claim using the following information.
For claiming procedure, refer to the online *Dealer/Distributor Warranty Guide*.

With BOSSWeb

CLAIM DETAILS	
Product Line	Roadster
Unit Model Year	2025
Campaign/Bulletin/Description	6 / 2025-6 / Canyon rust on bags latches

CLAIM DETAILS	
<div style="display: flex; justify-content: space-around; align-items: center;"> <div style="text-align: center;"> <p>*Action</p> <p>Inspect</p>  </div> <div style="text-align: center;"> <p>Repair</p>  </div> </div>	
Total Labor Time Paid	1.2 hours
Expiration Date	October 31, 2028

With Warranty on Demand

CLAIM DETAILS	
Claim Type	Unit Campaign
Serial Number	Enter Serial Number
Warranty Campaign	Select <i>2025-Canyon rust on bags latches / BULLETIN 2025-6 / 3WV-2025-0006</i> from the drop-down list
Date of Repair	Repair date
Total Labor Time Paid	1.2 hours
Expiration Date	October 31, 2028

[PRINTABLE PDF VERSION.pdf](#)