

Volvo Car USA LLC
Technical Journal

Technical Journal Title Rattle Noise from A-Pillar Panel		Ref. No. TJ 37539.1.0	
Issuer (Dept.) Technical Service		Issue Date 11/6/25	Status Date 11/18/25
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA	Function Group 8510	
Function Description upholstery for wall/door, side, rear she		Page Page 1 of 3	

Attachment

File Name	File Size
TJ_37539_1.jpg	0.1112 MB
TJ_37539_2.jpg	0.0833 MB
TJ_37539_3.jpg	0.0858 MB

DESCRIPTION:

If a customer complains about a rattle noise from the lower area of A-pillar panel, follow advice under "Service".

CSC Customer Symptom Codes

Code	Description
L4	Door interior trim panels/Loose, poor fit, warped, wrinkled
L5	Door interior trim panels/Tears, snags, cracks
T4	Interior moldings and fasteners/Interior fasteners loose, poor fit, warped

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
356							2025-9999		-	202417-999952

SERVICE:

1. Disassemble the A-pillar panel
2. Position felt-tape between the air duct and the A-pillar panel surface according to the picture (TJ_37539_1.jpg)
3. Position felt tape on the A-surface of the lower tip of the A-pillar panel and fold it over the edge according to the picture (TJ_37539_2.jpg)
4. Position felt tape on the air duct and air outlet according to the picture (TJ_37539_3.jpg)
5. Reassemble the A-Pillar panel

Felt-tape Part number: 30643492

Technical Journal 37539.1.0

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Please note that fault tracing is not eligible for separate reimbursement under this TJ. Any fault tracing VST operation numbers will be rejected.

Note, that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
98804-2	General Reimbursement acc. To TJ

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8521.

To view TJ attachments continue to next page. This TJ has three attachments.

