



## A/C Condenser Fan Relay

<b>Bulletin Type:</b>	TSB	<b>Publication Date:</b>	December 2025
<b>Bulletin #(s):</b>	25-025	<b>Make(s):</b>	Entegra Coach
<b>Job Code(s):</b>	9803643	<b>Model(s):</b>	Aspire, Anthem, Cornerstone, Cornerstone Reserve
<b>Flat Rate(s):</b>	9803643 .50 HR A/C Condenser Fan Relay Repair	<b>Model Year(s):</b>	2023-2026

<b>Incident:</b>	A/C Isn't blowing cold air
<b>Affected Units:</b>	2023-2026 Entegra Coach Aspire, Anthem, Cornerstone, & Cornerstone Reserve.
<b>Parts Kit: 25-025EC</b>	Parts Kit #: 25-025EC
	1 - HARNESS, RLY COND FAN 80A
<b>Misc. Tools &amp; Supplies:</b>	Wire Strippers Wire Crimper (Sta-Kons)/Terminal Crimper Screw Gun with Square Head Bit
<b>Parts Return Information:</b>	N/A

## A/C CONDENSER FAN RELAY REPAIR INSTRUCTIONS

WARNING

Indicates a potentially hazardous situation that, if not avoided, may result in death or serious injury.


WARNING

Ensure all power to the coach has been disconnected and the coach is fully powered off, prior to starting the repair.


1. Remove the panel covering the relay in the front drive side compartment. (Figure 1)




2. Locate the 40A relay for the condenser fans. (Figure 2)

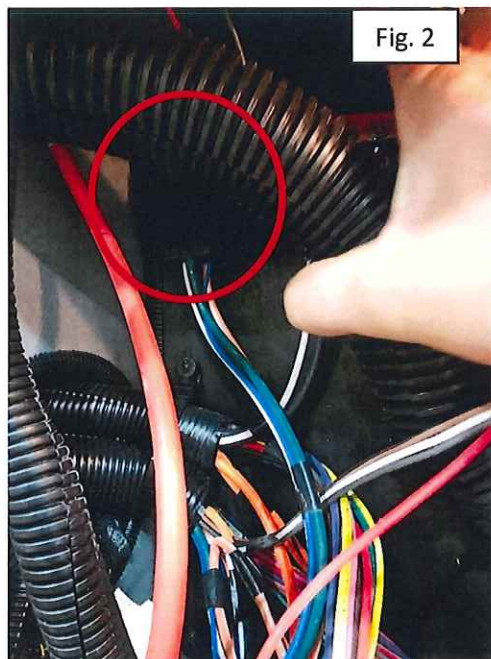

3. Remove the relay from the backer in the compartment with a screw gun and square head bit. Using wire strippers, cut the wires from the relay.
  - a. **Note: You will want to cut roughly 8-10" back from the relay.** (Figure 3)

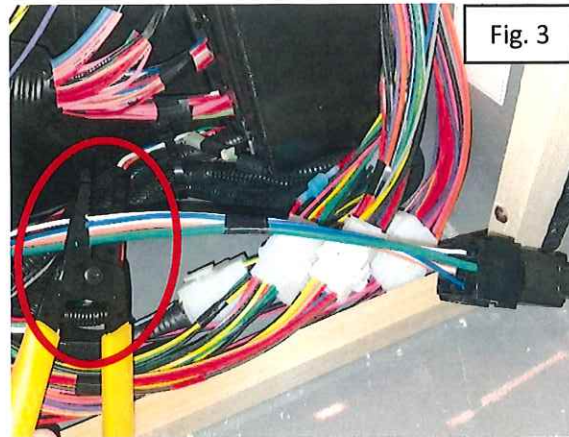

4. Use the wire strippers to strip the wires still in the coach.
  - a. **Note: You will only want to strip enough wire to use in the supplied butt connectors.** (Figure 4 – left hand side)

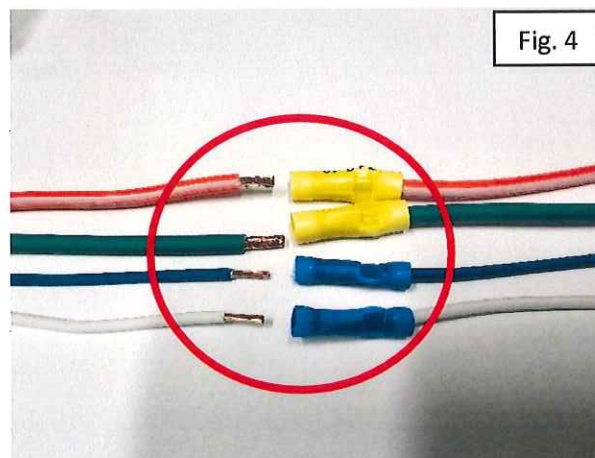

5. Use the butt connectors on the 80A relay assembly to wire the relay to the coach.
  - a. **Note: You will want to connect the wires matching color to color, (blue to blue, green to green, white to white and orange/white to orange/white)** (Figure 4 – right hand side)
6. Secure the new 80A relay assembly to the board in the same location the 40A relay was removed from.

*Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.*

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540



**Technical Service Bulletin Notification TSB #: 25-025**

**Unit Serial Number: DEVICEID»**

**December 2025**

«Name»  
«Address»  
«City» «State» «ZIP»

Dear Valued Dealer,

Jayco has determined that certain 2023-2026 Entegra Coach Aspire, Anthem, Cornerstone, & Cornerstone Reserve requires a repair for the Air Conditioner due to the A/C unit not blowing cold air. The repair is installing a new relay harness.

Our records indicate that the following vehicle is currently part of the inventory at your dealership and requires the Service Bulletin repair prior to being retail sold:

DEVICEID»

If you have sold this affected vehicle, please contact the current owner regarding this Service Bulletin and process the Warranty Registration for them. All pertinent information regarding this Service Bulletin is on file under the Case 25-025 TSB Lines in Jayco Partners.

If you have questions regarding this Service Bulletin, please contact the Jayco Customer Service Department at 800-283-8267.

Sincerely,  
Jayco Motorized Division



**Technical Service Bulletin Notification TSB #: 25-025**

Unit Serial Number: DEVICEID»

December 2025

«Name»  
«Address»  
«City» «State» «ZIP»

Dear Valued Customer,

Jayco has determined that certain 2023-2026 Entegra Coach Aspire, Anthem, Cornerstone, & Cornerstone Reserve requires a repair for the Air Conditioner due to the A/C unit not blowing cold air.

Our records indicate that your vehicle is affected by this Service Bulletin. Please contact your nearest Jayco dealer to schedule an appointment and present this letter as authorization to have the procedure completed at no cost to you.

«DEVICEID»

If you have sold or traded your vehicle, or for any reason cannot have this service performed, please contact the Jayco Motorized Customer Service Department at 800-283-8267.

We apologize for any inconvenience or concern this bulletin may cause and want to assure you that Jayco is taking all the necessary steps to ensure our product quality meets your expectations.

Sincerely,  
Jayco Motorized Division