

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: FRONT INNER BRAKE PAD PREMATURE WEAR	Bulletin No.: 04-003/25
	Last Issued : 12/23/2025

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
04-003/25	10/01/25

APPLICABLE MODEL(S)/VINS

2022-2023 MX-30

DESCRIPTION

Some vehicles may experience premature wear of the front inner brake pads. The pads wear down by about 0.1 in (3 mm) every 6200 miles (10,000 km), and may require replacement at less than 12,400 miles (20,000 km). This is caused by intrusion of dirt and sand into the gap between the pad and the rotor. To eliminate this concern, the shape of the dust cover has been changed, **and the brake pad chamfer shape has been revised.**

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the brake pads, and both dust covers with modified ones, instructions in MGSS (WHEEL HUB, STEERING KNUCKLE REMOVAL/INSTALLATION).

NOTE: If the front dust cover has already been replaced with the part listed below, replacement of the dust cover is not required. Only the brake pads should be replaced.

3. Verify the repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
D69R-33-261	Cover-Dust, F RH	1	
D69R-33-271	Cover-Dust, F LH	1	
D651-33-042A	Nut	2	[R]
T060-26-169A	Pin Snap	2	[R]
DNYJ-33-28ZD	Pad, Sub Set, Frt Caliper	1	

[R]: Replacement parts

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	94
Damage Code	9C
Part Number Main Cause	7777-SP-Y48
Quantity	0
Operation Number / Labor Hours:	XXWRNXXRX / 0.8 Hrs. (Dust cover and pad replacement) XXWRNARX / 0.4 Hrs. (Pad replacement only)

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.