

Subject: DTC U0415:68 - VCM CANNOT BE CLEARED AFTER DSC REPLACEMENT	Service Alert No.: SA-057/25
	Last Issued : 12/04/2025

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2025-2026 CX-70

2024-2026 CX-90

DESCRIPTION

A technician may report that DTC U0415:68 - VCM (Vehicle Control Module) cannot be cleared after replacing the DSC (Dynamic Stability Control) module.

REPAIR PROCEDURE

Using M-MDS, implement [Self-Diagnosing Brake Line] using the following procedure:

1. Connect the M-MDS to the DLC-2.
2. Switch the main power ON (READY off).
3. Activate M-MDS and perform the following procedure.
 - a. Press [Start] for the vehicle identification.
 - b. Press [Toolbox] tab.
 - c. Press [Work Support] icon.
 - d. Press [BRAKES].
 - e. Press [Run] on the self-diagnosing brake line.
 - f. Clear the DTC.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.