



SIB 64 11 25

INSUFFICIENT COOLING POWER IN PASSENGER AREA

2025-12-16

<input checked="" type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
<input type="checkbox"/>	THIS REPAIR IS REMOTE SOFTWARE UPGRADE (RSU) FRIENDLY

This Service Information bulletin (Revision 01) supersedes SI B64 11 25 **dated November 2025**

What's New:

- Repair Code updated in the Claim Information Section.

MODEL

E-Series	Model Description	Production Date
G26	i4 BEV	Vehicles produced up to July 2024

SITUATION

Insufficient cooling power in the passenger area.

The following faults may be stored:

- **0380CA** - Malfunction or electrical fault of the heat pump circuit expansion valve detected
- **E70C51** - Heat pump circuit changeover valve is not responding
- **E70C44** - Heat pump circuit expansion valve is not responding

CAUSE

Integrated automatic heating/air conditioning system (IHKA control unit) hardware.

CORRECTION

Replace the IHKA control unit.

PROCEDURE

Important Warning for Working on the High-Voltage (HV) systems on BMW Group vehicles:

Only properly trained personnel, who passed all applicable HV Technical Training Courses, should perform repairs which require disconnecting, or removal of High Voltage battery components on any Hybrid or Electric Vehicle. Work performed on High Voltage systems by unqualified persons may result in severe injury or damage to the vehicle. Additional safety information is found in Repair Instruction 61 00... "Observe safety instructions when handling electric vehicles".

Prior to disconnecting, or the removal of any HV component, the HV system needs to be disabled and secured (by means of the HV Service Disconnect Switch and lock out) by a properly trained HV technician, who has a minimum HV Qualification level after completing the Technical Training Course "ST2324 High Voltage Drivetrain Systems" which as of 1/2023* includes ST1824 Alternative Drive Part 1.

*** Note: As of January 2023, the HV component portion of the "ST2205 Generation 5 High-voltage class" (except for the High Voltage Battery) has been merged into "ST2324 High Voltage Drivetrain Systems".**

Up to Generation 4 Vehicles once vehicle's HV system is disabled (the "Blitz" - lightning bolt icon is displayed in instrument cluster, see below), a technician without HV Certification may remove a HV

component (e.g., EH Heater, EKK Compressor, EME Control Unit, et.), except for the High Voltage Battery.

For Generation 5 Vehicles however, the specific vehicle training is required to diagnose, remove and service any HV component and it is NOT allowed for non HV certified technicians to work on the high voltage system.



High Voltage Battery removal and rework can ONLY be performed by a High-voltage Certified Technician with a HV Battery Certification level corresponding to a specific Electric or Hybrid vehicle, for example:

To repair GEN4 HV battery of G05 PHEV a certification from Technical Training Course “ST2006 – SP44 HV Battery” or equivalent ST1825 – Alternative Drive Part 2 is required (or as of 1/2023 the equivalent “ST 2325 for High Voltage Battery Systems”).

And

To repair A GEN5 HV battery the Technical Training Course “ST2205 Generation 5 High-voltage class” is required or as of 1/2023* the equivalent “ST 2325 for High Voltage Battery Systems”.

***Note: As of January 2023, the “ST2205 Generation 5 High-voltage stand-alone class” has been merged into “ST2324 for High Voltage Drivetrain Systems” and “ST2325 for High Voltage Battery Systems”**

First, review the Repair History (Claims) section at the bottom of the VIN-specific Warranty Vehicle Inquiry (WVI) to confirm that a prior claim for this repair procedure has not been recently submitted and accepted.

Replace the IHKA control unit as per repair instructions REP **64 11 692**.

Program the vehicle after installation of the new IHKA control unit.

Note that ISTA will automatically reprogram and code all programmable control modules that do not have the latest software.

Always connect a BMW-approved battery charger/power supply (SI B04 23 10).

For information on programming and coding with ISTA, refer to TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

PARTS INFORMATION

To determine the part number(s) that applies to the specific vehicle being repaired, enter the VIN / Chassis number into either ETK or AIR, this will consider the specific equipment and/or options that are fitted to the vehicle.

Part Number	Description	Quantity
Refer to AIR/ETK	Control unit air conditioning sys.	1

Additionally, other materials and small parts that are not specified above, such as fluids, lubricants (in sublet), one-time use screws, nuts, and seals, which must be replaced or installed (according to the ISTA

BMW Group's resources according to the respective vehicle type. Invoiced these items separately under the Repair Code listed in this bulletin.

CLAIM INFORMATION

Vehicle Programming and Encoding

During this workshop visit, the affected vehicle may also show one or more programming and encoding Technical Campaign repairs open, the programming and encoding procedure may only be invoiced one time.

After replacing the "Control unit air conditioning sys," select one of these open Technical Campaigns instead to perform and submit for updating the vehicle to the required I-level, or higher when applicable (Includes labor operation codes 00 00 006/556, 61 21 528 and 61 00 730).

Please be sure to also perform any additional before and/or after work (including attaching labels) as required by the open campaigns on the vehicle. Close any remaining open programming and encoding Campaign repairs as outlined in the corresponding Service Information Bulletin.

Based on the above, covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks, or the BMW Certified Pre-Owned Program as described below.

Repair Code:	6411230200	Control unit of front heating and air conditioning system Software error / internal device fault
---------------------	-------------------	---

Obtain the flat rate unit (FRU) allowances for the following that applies.

Labor Operation	Description	Labor Allowance
00 00 006	Carrying out vehicle test (Main work)	As applicable
Or:		
00 00 556	Carrying out vehicle test (Plusposition)	As applicable
And:		
61 21 528	Supporting voltage of the vehicle electrical system / recharging vehicle battery	As applicable
And, as needed:		
61 00 006*	Carrying out vehicle diagnosis, ABL (Work time)	WT FRU
Or:		
00 58 500*	Diagnosis Worktime Flat Rate	2 FRU
And:		
64 11 692	Replacing control unit for air conditioning system (after vehicle diagnosis)	As applicable

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006, or exclude them (including 61 21 528) when the Vehicle Test is included in another repair.

Work time labor operation codes 61 00 006 and 00 58 500 are not considered Main labor operations.

And with:

No Open Programming and Encoding Technical Campaign Repair

Labor Operation	Description	Labor Allowance
------------------------	--------------------	------------------------

Copyright ©2025 BMW of North America, Inc.

61 00 730	Program/encode control unit(s), includes deleting the fault memory	As applicable
-----------	--	---------------

Vehicle Programming and Encoding – Additional Work (RO and Claim Comments Required)

This procedure automatically reprograms and encodes any vehicle control modules that do not have the latest software I-level.

If one or more control modules fail during the reprogramming procedure, claim the required consequential repair work procedures to address this issue (including performing the IRAP Control Unit Recovery first as required, refer to the SIB in AIR) under the Repair Code in this bulletin together with the corresponding labor operation codes and their flat rate unit (FRU) allowance(s), including the diagnosis* that applies.

Please explain the additional work procedures that were performed (The why and the what) on the repair order and in the claim comments.

For covered repairs that address control module failures that occurred prior to performing this reprogramming procedure, claim this work with the applicable Repair Code listed in AIR together with the corresponding labor operation codes and their flat rate unit (FRU) allowance(s), including the diagnosis* that applies.

(*) Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for the applicable procedure for documenting, claiming, and explaining, on the RO and in the claim comments, your diagnosis work time (WT), job/repair work time (WT), and the vehicle repairs your center performed, unless otherwise required by State law.

BMW Group's AIR Application Resource for Flat Rate Labor Operation Codes

To obtain the corresponding flat rate unit (FRU) allowance information from the BMW Group AIR application resource, start by entering the the Chassis Number (last seven (7) characters of the VIN), and click on the "Search" icon. If the "Vehicle Selection" window displays two or more model possible vehicle choices, select the applicable Model, or enter the full VIN (17 characters) instead to proceed. Click on the "Flat Rate Units" button and enter a flat rate labor operation code number "without spaces" in the field to the right, click on the "Search" icon to display the corresponding listing of "Flat rate unit group details" that are available and their corresponding FRU allowances.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

