

VN(4) Cab Leveling Bar Loose

Release: 1**Technician Skill Level:** A**Revision Note:** 12/2025 Initial Release**Market:** North America**Service Category:** Service Department**Applicability:** Please refer to VDA+**Section:** Function Group 818**Description:**

The vehicle's Panhard rod mounting brackets may have incorrect hardware installed resulting in unintended cab movement.

Concern:

Use of incorrect hardware during assembly could result in rough ride, cab vibration, and/or cab airbag failure.

Action:

Follow the instructions in this document to replace the Panhard mounting bracket hardware.

Warranty Information

This repair is covered by an authorized Service Program. Reimbursement is obtained through the normal claim handling process.			
Claim Type (used only when uploading from the Dealer Bus. Sys.)			B
Labor Code		Description	Total Hours
Main Code	8181-03-02-35	Panhard Rod Bracket, Replacement	1.0
Causal Part		984816	
SCC Authorization Code		S4674	
Expiration Date		December 31, 2026	

Parts Information


Order parts following the normal ordering process.

Part Numbers	Part Names	Quantity
60114105	Grade 10.9 Flange Screw	4
60115330	Spacer Washer	4
60116889	Flange Locknut	4

VN(4) Cab Leveling Bar Loose

Repair Procedure


1. Park the vehicle on level surface.
2. Apply parking brake.
3. Place the transmission in park or neutral.
4. Turn off ignition.
5. Install wheel chocks.

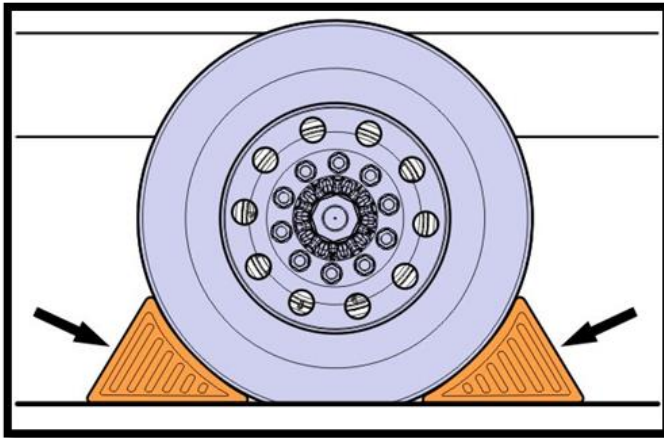

6. Follow **Impact procedure 8181-03-02-35 Panhard Rod Bracket, Replacement** to replace all suspected hardware. Brackets will be re-used. **Replace only the bracket hardware and torque to specification.**

Tightening torque	
Grade 10.9 Flange Screw (PN: 60114105)	105 ± 20 Nm (77 ± 15 lbs·ft)

7. Remove wheel chocks.

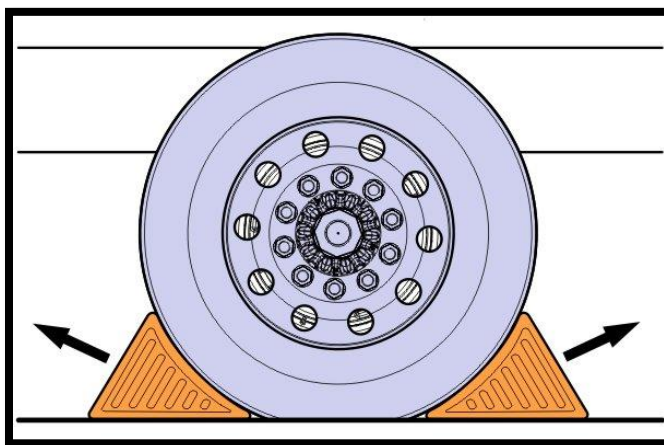

8. Release truck for service.