

Independent Switching On and Off of the Reading Lights in the Front Roof Console (96/25)

Model Line: **Cayenne (9YA/9YB)**

Model Year: **2024**

Concerns: **Front roof console**

Cause: **The customer complains that the reading lights in the roof console switch on and off independently.**

Cause: Unfavorable material pairings between the touch antenna and the printed circuit board can activate the customer complaint.

Action: For such customer complaint, replace the existing front roof console with a front roof console with a new component status.

Required parts

Parts Info:	Part No.	Designation – Location	Number
	Required parts for vehicles without roof insert (M-No. 3FA) or with carbon roof (M-No. 3FF)		
	9Y0959551ATTMO	⇒ Roof console – without E-Call & B-Call (M-No. IW0) or – with B-Call (M-No. IW2)	1 piece
	or		
	9Y0959551BATMO	⇒ Roof console – with E-Call (M-No. IW1) or – with E-Call & B-Call (M-No. IW3)	1 piece
	Required parts for vehicles with glass roof (M-no. 3FG):		
	9Y3959551P TMO	⇒ Roof console – without E-Call & B-Call (M-No. IW0) or – with B-Call (M-No. IW2)	1 piece

or

9Y3959551Q TMO ⇒ Roof console 1 piece
– with E-Call (**M-No. IW1**)
or
– with E-Call & B-Call (**M-No. IW3**)

Required parts for vehicles with Porsche large roof system (M-No. 3FU):

9Y0959551BBTMO ⇒ Roof console 1 piece
– without E-Call & B-Call (**M-No. IW0**)
or
– with B-Call (**M-No. IW2**)

or

9Y0959551BCTMO ⇒ Roof console 1 piece
– with E-Call (**M-No. IW1**)
or
– with E-Call & B-Call (**M-No. IW3**)

Required tools

- Tools:
- **P90999 - Porsche Tester 4**
 - Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*
 - Plastic wedge, commercially available

Replace front roof console

- Work Procedure: 1 Replace the existing front roof console with a front roof console with a new component status.
⇒ *Workshop Manual '708319A4 Removing and installing front roof console'*
⇒ *Workshop Manual '708355 Replace front roof console'*

Labor position and PCSS encryption



Information

The fault pattern described in this technical information is covered by the technical warranty extension "Warranty information: Warranty extension for front roof console (95/25)".

⇒ Technical Information '708355 Warranty information: Warranty extension for front roof console (95/25)'

Labor position:

APOS	Labor operation	I No.
70835500	Replace front roof console	

PCSS encryption:

Location (FES5)	70830	Front roof console
Damage type (SA4)	4011	Loose contact, contact fault

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

©2025 Porsche Cars North America, Inc.