

SS 582821 Steer Tag Axle Dog Tracking

Applicable Vehicles

XC Chassis equipped tag steer axle.

Symptoms

Unit dog tracking, uneven tag axle tire wear, premature tag axle tire wear.

Issue

When the tag axle steer chambers are engaged in the "lock" position, the locking mechanism extends beyond the upper spec limit, potentially creating a misalignment at the wheel end.

Solution

Replace chambers with PN R-021302-00 or order service kit R-21303-00 replace with new components in kit.

Labels :

RV and Motorhomes

Add tags



2 Kudos

Comment

