

Front Display and Control Panel Replacement Required: Procedure to be Observed for Component Replacement (98/25)

Model Line: **911 (992)
Taycan (Y1A/Y1B/Y1C)
Panamera (YAA/YAB)
Cayenne (9YA/9YB)**

Model Year: **As of 2024 up to 2025**

Concerns: **Replacement requirement for front display and operator control panel (central display and/or front passenger display)**

Cause: **It is possible that spare part displays are currently still in the inventories that do not have the last planned software release.**
Non-current software releases can cause the display and control panel to flicker at the front, occasionally fail or display content in a distorted/divided manner. ⇒ *Exemplary representations of possible complaints due to software releases that are not up-to-date.*



Exemplary representations of possible complaints due to software releases that are not up-to-date.

Action: If the central display or passenger display needs to be replaced, the software release of the **new** display **must** be checked after installation.

If the software release of the respective affected display **is smaller than listed in the "Software overview" table**, perform the software update described in Technical Information 221/24.

⇒ *Technical Information '911000 The front display and control panel flickers or fails intermittently (221/24)'*

Software overview:

Model line	Software release Central display	Software release Passenger display
911 (992)	"0170" (or higher)	–
Taycan (Y1A/Y1B/Y1C)	"0270" (or higher)	"0560" (or higher)
Panamera (YAA/YAB)	"0120" (or higher)	–
Cayenne (9YA/9YB)	"0110" (or higher)	"0610" (or higher)

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

©2025 Porsche Cars North America, Inc.