

## 21MY ONWARD F-PACE REAR TAIL LAMP FUNCTION

### Customer Voice:

- “My turn signal doesn't work and I am getting a fast flashing indicator in the instrument cluster”

### Technical Description:

- A concern has been identified with the body tail lamp assemblies on 23MY and newer F-PACE where LED function may be lost intermittently when Turn Signal is operated.
- This will present as a “fast flash” indicator in the instrument cluster to indicate the lamp is not operating.
- The fault condition will set DTC's below in the BCM depending on whether left and/or right side faults.
  - C111A-15 Left Stop Lamp - Circuit short to battery or open
  - C111B-15 Right Stop Lamp - Circuit short to battery or open
- Fault condition will clear with lamp function restored after a vehicle ignition cycle.

### Action:

Revisions to **SSM76374** are under review for updated work instructions. Process below will be in revised SSM

- Review lamps for physical defect and rectify if found.
- If no immediate physical defects found, proceed with completion of TOPIx application **SSM 76374 - Tail Lamp Turn Signal Fast Flash** located under BCM Module
- Allow vehicle to sleep then confirm update lamp function prior to release.

Note: TA escalation is no longer required. Vehicles may be diagnosed and repaired with the application noted above.

Please raise EPQR's to report vehicles that have required this application run to correct fault condition.

Jaguar

- 21MY-On F-PACE



Vehicle    Module

BCM

BCM - SSM 76374 - Tail Lamp Turn Signal Fast Flash