

DD13 Classic Oil Pan Bolt/Isolator Deterioration

Issue Description Oil leaks/low mileage deterioration of oil pan mounting bolt isolator

Status & Details Failed rubber isolators compared to conforming material. Supplier changed isolator material. Non-conforming material; 18x bolt assemblies/pan.

Field Action **If leaking**, follow 23TS-03 to remove oil pan & replace isolators & submit to warranty. **If not leaking**, do not drain oil or remove the oil pan. Remove and replace individual isolators with new conforming material
Service kit: DDE 23565378 (kit w/ 18x isolators)

Identifying Features DD13 471928S0783001 - 471928S1018355 w/ Premix oil pan

Reference Documentation 23TS-03

Additional Information [Related: Gen 5 DD13 changed over to non-isolated pan Sept 1, 2022 ESN HDE0989555](#)

