



# HUSQVARNA TECHNICAL BULLETIN HTB2508 – USA

DECEMBER 1, 2025

**RECALL: THIS MODIFICATION HAS TOP PRIORITY AND MUST BE PERFORMED IMMEDIATELY TO ENSURE CUSTOMER SAFETY**

## SOFTWARE UPDATE ENGINE CONTROL UNIT

### AFFECTED MODELS:

**2024 SVARTPILEN 401**

**2024 VITPILEN 401**

### RESTRICTIONS: AFFECTED MODELS ARE LINKED BY VIN IN DEALER.NET

#### BASIC INFORMATION:

Husqvarna Mobility North America, Inc. has determined that a defect which relates to motor vehicle safety exists with certain model motorcycles listed above pertaining to the engine control unit software.

An issue with the originally installed engine control unit software may cause the engine to stall at low rpms.

A loss of engine power increases the risk of a crash which could cause injury to the rider or others and/or damage to property.

To remedy this defect, it is necessary to install the updated engine control unit software on all affected motorcycles.

Husqvarna Mobility North America, Inc. is notifying all registered owners of affected motorcycles by mail. A copy of the customer letter is included in this bulletin. The customer should take the letter along with the affected motorcycle to an authorized Husqvarna motorcycles dealer to have the updated engine control unit software installed.

Dealers must perform the engine control unit software update on all affected model motorcycles in their inventory prior to any customer delivery. Any of the affected model motorcycles received directly from Husqvarna Mobility North America, Inc. require the engine control unit software update prior to customer delivery. Affected motorcycles acquired through dealer transfers or trades must be remedied and checked in Dealer.net to ensure and document that the repair has been performed.

#### COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

#### LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved

Motorcycles that are affected must not be sold or operated until the repair procedure has been performed as described in this bulletin. It is a violation of Husqvarna Mobility North America, Inc. policy for an authorized Husqvarna motorcycles dealer to deliver any affected motorcycles to customers before the procedure in this bulletin has been performed.

Husqvarna Mobility North America, Inc. must report to the federal government on a regular basis how many motorcycles have been repaired during this campaign. Be sure to submit your warranty request for reimbursement on every motorcycle repaired to ensure accurate compliance numbers.

### PROCEDURE FOR REPAIR:

We shall not provide a description of general workshop methods. Likewise, safety rules that apply in a workshop are not specified here. It is assumed that the repair work will be performed by a fully trained mechanic who has completed training or has a corresponding qualification. In the event of uncertainty, the most recent repair manual must be consulted.

In the interest of clarity, some components may be shown disassembled or may not be shown at all. It is not always necessary to disassemble the component to perform the activity in question. Please follow the instructions in the text.

### Software update engine control unit

- Connect vehicle to the diagnostic tool and external voltage supply (XCharge) as shown in Figure XC\_2.

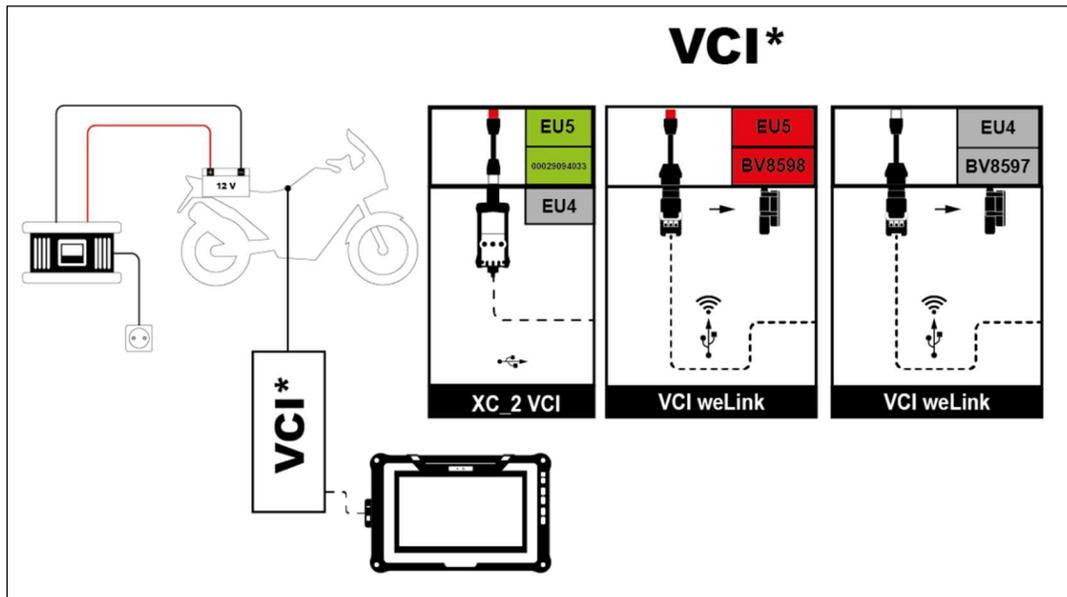


Fig. 1: Connection diagram for XC\_2

#### COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

#### LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved



- Select the engine control unit and update the appropriate software (see Table. 1).
- After successfully updating, switch off the ignition system for at least 1 min.
- Switch on the ignition (key and stop switch) and wait 30 seconds.

**Attention:**

The engine must be switched off and the throttle grip must not be operated.

- Clear fault memory.
- Switch the ignition off and on again.
- Start the vehicle and allow it to idle for at least 3 fan cycles.

**Attention:**

Do not operate the throttle grip.

- Switch ignition off and on again.
- Select control unit diagnostics and run AutoScan.
- Check all control units for possible errors and if present, delete them inside the respective control unit menu.

**Attention:**

Do not press the “delete all faults” button, because also the important engine control unit data is getting deleted with this.

If the “delete all faults” button was pressed, the initialization run must be performed again to finish this routine.

**Table 1**

|                            |
|----------------------------|
| Software number <b>NEW</b> |
| KM963EU2596003             |

**VEHICLE LOCK INFORMATION:**

Unsold motorcycles that are linked to this recall are locked in the vehicle history. The vehicle lock prevents the motorcycle from being retailed to a customer before the recall is performed. In order to unlock the vehicle you must perform the recall and then submit a TI claim. After the TI claim is submitted it will be possible to unlock and retail the motorcycle.

**COPYRIGHT NOTICE**

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

**LIMITATION OF LIABILITY**

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved



**WARRANTY INPUT INFORMATION:**

**This Technical Bulletin only affects certain VIN numbers! Please check the VIN by performing a Motorcycle History search in Husqvarna Dealer.net to determine if it's affected. If the motorcycle is affected you will see a link to the bulletin and its repair status in the history results. Husqvarna Mobility North America, Inc. will not warranty units whose VIN numbers are not listed as this bulletin does not apply to them. It is the responsibility of the dealer to determine if the unit requires this update by checking the vehicle history and understanding the instructions provided by this bulletin.**

To submit a TI claim click the arrow on the right side of the corresponding technical information message to start the claim process.

You can now choose the TI Number from the list. The TI number for this procedure is according to the repairs performed and listed in the warranty claim input information; click **Continue with selected action code**. The Warranty Claim is automatically entered for you, including parts & labor. You must enter additional information in the required fields marked with an asterisk "\*" before submitting the claim to Husqvarna motorcycles. The flat rate time for this repair is based on the action performed and provided in minutes.

|  |
|--|
| <b>Warranty type:</b>                      |
| TI-Warranty                                |
| <b>Assembly group:</b>                     |
| 41 – Throttle Body                         |
| <b>Failure code:</b>                       |
| 700 – Serial Improvement                   |
| <b>Failure causing part:</b>               |
| 96341031000 – ECU EMS                      |
| <b>Action code, parts, labor:</b>          |
| <b>Software update engine control unit</b> |
| Action code: <b>41_2598839_00</b>          |
| Labor: <b>10 Minutes</b>                   |
| Parts: <b>-</b>                            |
| <b>Are stock parts affected</b>            |
| <b>No</b>                                  |

**COPYRIGHT NOTICE**

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

**LIMITATION OF LIABILITY**

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved



## IMPORTANT SAFETY RECALL NOTICE NHTSA Recall No. XX-XXXX

This notice applies to your motorcycle, VIN: «Vin»  
«PdiFirstName» «PdiLastName»  
«PdiAddress1»  
«PdiCity», «PdiProvince» «PdiPostalCode»

12/xx/2025

**RE: Affected models:**  
**2024 SVARTPILEN 401**  
**2024 VITPILEN 401**

Dear Husqvarna motorcycle customer,

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Husqvarna Mobility North America, Inc has determined that a defect which relates to motor vehicle safety exists with certain model motorcycles listed above pertaining to the engine control unit software.

An issue with the originally installed engine control unit software may cause the engine to stall at low rpms.

A loss of engine power increases the risk of a crash which could cause injury to the rider or others and/or damage to property.

To remedy this defect, dealers will install the updated engine control unit software on all affected motorcycles, free of charge.

Please contact your authorized Husqvarna motorcycles dealer (log onto [www.husqvarna-motorcycles.com](http://www.husqvarna-motorcycles.com) for a complete dealer listing) as soon as possible to arrange having the updated engine control unit software installed. It is suggested that you call your local authorized Husqvarna motorcycles dealer to make an appointment to have the recall repair performed. The procedure will take approximately 30 minutes. However, it may be necessary to leave your motorcycle with the dealer for a longer period of time depending on their work schedule and if they need to order replacement parts. Please present a copy of this letter along with your motorcycle to your local authorized Husqvarna motorcycles dealer.

If you have any questions related to the content of this letter, please contact Husqvarna Mobility North America, Inc. Customer Relations at (888) 985-6090 for assistance.

If your dealer fails or is unable to remedy this defect without charge, or within a reasonable amount of time, you may submit a written complaint to Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, DC 20590 or call 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.nhtsa.gov>

If you have sold, traded or no longer own this motorcycle, it is important for the safety of the current owner that you inform Husqvarna Mobility North America, Inc. of current ownership or unknown ownership status by returning the second page of this letter in the enclosed self-addressed prepaid postage envelope.

If you are a vehicle lessor, Federal Regulations require you to forward this notice to your lessee within ten days.

#### COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

#### LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved

**Husqvarna Mobility North America, Inc.**  
30125 KTM Way | Murrieta, CA 92563  
1119 Milan Ave. | Amherst, OH 44001  
8701 Samuel-Hatt | Chambly, QC, J3L 6V4

**Dealer Services Department**  
P: 855- 282-1054  
[www.husqvarna-motorcycles.com](http://www.husqvarna-motorcycles.com)



If you have already paid for a repair related to this concern before the date of this letter, you may be eligible for reimbursement. Please contact Husqvarna motorcycles Customer Relations at the number above for more information.

We apologize for any inconvenience and want to assure you that our commitment together with all Husqvarna motorcycles dealers is to provide you with the highest level of service, support and customer satisfaction.

Best Regards,  
Dealer Services Department  
Husqvarna Mobility North America, Inc.

**COPYRIGHT NOTICE**

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

**LIMITATION OF LIABILITY**

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2025 Husqvarna Mobility North America, Inc. – All rights reserved