



Service Bulletin

Bulletin No.: PIP6070B

Date: January, 2026

PRELIMINARY INFORMATION

Subject: DTC P06DD Set Current Or History May Have An Oil Consumption Concern

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Envision	2024-2026		All	All	2.0 LSY	All

Involved Region or Country	North America
Condition	DTC P06DD set as current or in history
Cause	Possible low engine oil level, oil consumption concern

Correction

If you encounter the above-mentioned vehicle with DTC P06DD set as current or in history perform the following steps.

1. Check and verify the oil level. If the oil level is within the hashmarks of the dipstick, go to step 3. If the oil level is not showing on the dip stick, go to step 2.
2. Perform Oil and Oil Filter Change. Drive the vehicle to confirm P06DD will clear, If the code does clear, perform oil consumption testing per bulletin 01-06-01-011. If the code does not clear, go to step 3.
3. If P06DD is still present, Perform P06DD diagnostics per Service Information.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4082448*	Step 1 - P06DD diagnosis / Check Engine oil level and road test	0.3 Hr.
Add Time	Only use if following Step 2 - Change Engine oil and Filter/road test to confirm p06DD	0.7 Hr.

*This is a unique Labor Operation for Bulletin use only.

Version	3
Modified	06/11/2025 - Created 01/09/2026 Updated diagnostic steps under correction 01/23/2026 - Updated title and correction sections to include verbiage "oil consumption, oil consumption testing" . Added keywords

