



## Technical Service Bulletin

<b>GROUP</b>	<b>NUMBER</b>
<b>CAMPAIGN</b>	<b>26-01-012G</b>
<b>DATE</b>	<b>MODEL(S)</b>
<b>JANUARY 2026</b>	<b>G80 (RG3)</b>

**SUBJECT:** DCU SOFTWARE UPDATE  
(SERVICE CAMPAIGN T73G)

This TSB supersedes 25-01-057G to add additional information for VCI 2 connection and IP settings on pages 4-5.

### \* IMPORTANT

Retailers must perform this service campaign on all affected vehicles prior to retail delivery to a guest and whenever an affected vehicle is in the shop for any maintenance or repair.

Access the "Vehicle Information" screen via WebDCS to identify open campaigns.

**Description:** Certain G80 (RG3) vehicles may exhibit a Data Communication Unit (DCU) software error due to the internal timer initialization logic not being implemented. The DCU module may shut down telematics services after one year. This bulletin provides instructions to perform a software update for the DCU module.

### Applicable Vehicles (Certain):

Model Year	Model	Production Dates
2025 – 2026	G80 (RG3)	06/03/2024 – 07/24/2025

### SST Information:

Tool Name	Tool Number	Figure	Remarks	Ordering Information
VCI 3	G0VPNNN006		VCI 3 comes with the 19-pin cable (P/N G1XDDCA020 included here for reference)	Website: <a href="https://genesisessentialtools.com/">https://genesisessentialtools.com/</a>  Email: <a href="mailto:Genesisistools@snapon.com">Genesisistools@snapon.com</a>  Phone: 1-855-763-6630 Hours: 7 AM – 7 PM CST
19-Pin Cable	G1XDDCA020			
VCI 2	G1XDDMN002		If using VCI 2, the ECI Kit will be required to complete software updates.	
Ethernet Communication Interface (ECI) Kit	G0XDDMN052			

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

**GDS Information:**

Model	System	Event Number*	Description
G80 (RG3)	DCU	1249	RG3 PE DCU LOGIC IMPROVEMENT

(\*or use a later available event as listed in the GDS DCU Update screen if one is available.)

**NOTE 1:** The software update is subject to an OTA (Over-the-Air) option and may be completed by customers with active Genesis Connected Services subscriptions.

**Warranty Information:**

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
G80 (RG3)	50D218R0	DCU Software Update	0.4 M/H	96510-T1AC0	I14	ZZ3

**NOTE 1:** Submit claim on Claim Entry Screen as "Campaign" type.

**NOTE 2:** If a part is found in need of replacement while performing this campaign and the affected part is still under warranty, submit a separate claim using the same repair order. If the affected part is out of warranty, submit a Prior Approval request for goodwill consideration prior to performing the work.

**NOTE 3:** This TSB includes repair validation photos. Op times include VIN, mileage, and photo capture of the ECU Update "Success" screen as outlined in the Digital Documentation Policy.

**ROM ID Information:**

Model	Event	System	ECU Part Number	ROM ID	
				Current	Latest
G80 (RG3)	1249	DCU	96510-T1AC0	120.NA.011509.011509	120.NA.012054.012054
				120.NA.011606.011606	
				120.NA.011870.011870	
				120.NA.011951.011951	

**Service Procedure:****DIGITAL DOCUMENTATION**

This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

**NOTICE**

**You must initially perform the GDS ECU update in Auto Mode.**

- If the ECU update starts but then fails in Auto Mode, perform the update in Manual Mode to recover.

**NOTICE**

Ensure the vehicle's battery charge is **above 11.0 Volts** and the tablet's battery charge is **above 30%** before performing a software update to avoid update failure.


***i* Information**

- Turn **OFF** all lamps (do **NOT** leave head lamp switch in auto mode) and all accessories.
- Perform update with the ignition switch in the **ON** position.
- Do **NOT** disconnect any cables connected to the vehicle or scan tool during the update.
- Do **NOT** start the engine during the update.
- Do **NOT** turn **OFF** the ignition switch during the update.

Configuration of Ethernet Communication on Tablet


VCI 2 Connection (must use ECI kit with USB-C cable attachment):

1. Connect the ECI DLC connector to the OBD connector of the vehicle.
2. Connect the VCI to the receiver module on the ECI cable.
3. Connect the ECI cable with the USB-C connector cable attachment to the tablet.

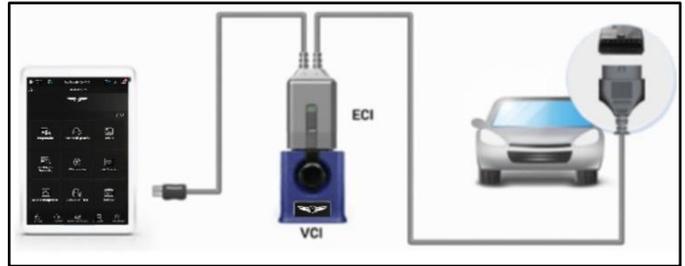


VCI 3 Connection (use VCI 3 cable):

1. Connect the 19-pin connector to the bottom of the VCI 3.
2. Connect the VCI to the OBD connector of the vehicle.
3. Connect the cable with the USB-C connector to the tablet.

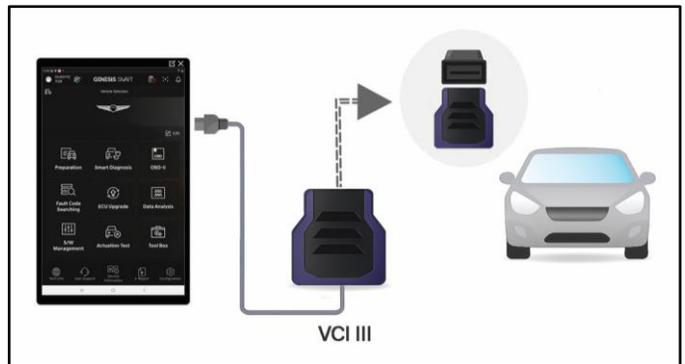

**i Information**

- If using VCI 2, please wait for the **Wi-Fi Direct** timer to complete to ensure the **Wi-Fi Direct** connection is established. Do **NOT** select **Bluetooth Only**.

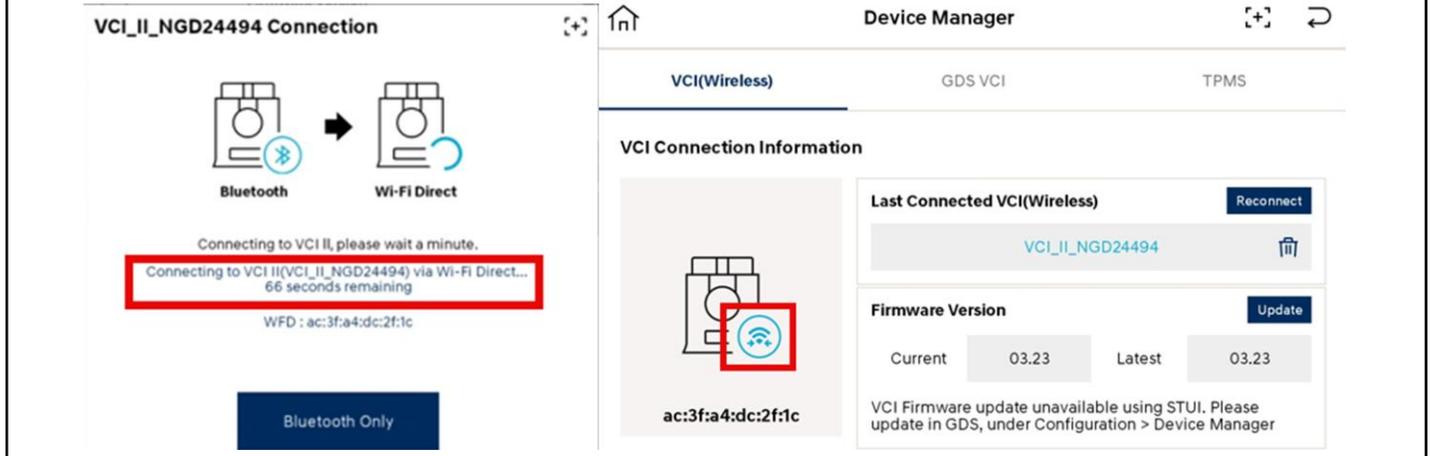

ECU Update Procedure

1. Enter the following digits exactly as shown for IP address, DNS address, Netmask and Default gateway.

Save and close.

**IP address – 10.0.128.0**

**DNS address – 8.8.8.8**

**Netmask – 255.0.0.0**

**Default gateway – 10.0.128.0**

**i Information**

Ensure the following IP settings on your tablet matches the below before proceeding with the software update.

Select Ethernet device  
eth0

Connection type  
 DHCP  
 Static IP

IP address  
10.0.128.0

Netmask  
255.0.0.0

DNS address  
8.8.8.8

Default router  
10.0.128.0

DISCARD SAVE

2. Perform the ECU update in **Auto Mode**.

**i Information**

Refer to **TSB # 24-GI-016G**, “ECU Update Procedure for Tablet-Based Genesis Smart”, for additional information.

ECU UPGRADE 1.307

KMKUCDTC2PU012969 GV60(JWI EV)/2023/74KW+160KW

SELECT ECU UPGRADE MODE

AUTO MODE

MANUAL MODE

OTA MANAGEMENT VERSION UPDATE

- Verify the ROM ID by selecting the **DCU** system to scan the vehicle's current ROM ID.

**NOTICE**

Check the current ROM ID version and compare it to the ROM ID Information table before attempting to perform the software update.

**NOTICE**

If the update fails, remove the power connector from the in-cabin fuse box, or disconnect the negative (-) battery terminal for at least **5 seconds**. Reassemble and retry the update.




- After the ECU update process shows 100% complete, follow the prompts on the screen to cycle the ignition **OFF** for at least **10 seconds** to reset the control unit (certain models may take up to **30 seconds**).





**Information**

Use the **Refresh** button to reset the timer.

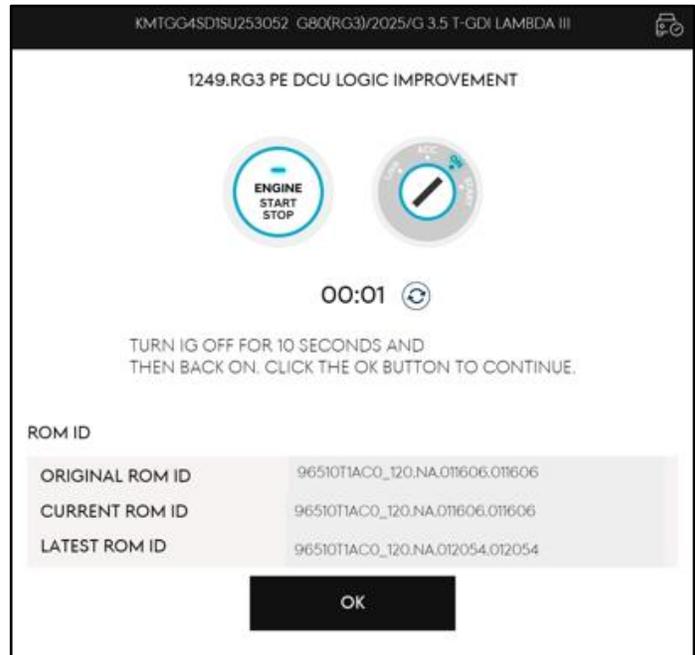

5. OTA initialization (A) should perform automatically:
  - If OTA initialization performs automatically, then proceed with the service procedure.
  - If the OTA initialization process fails, complete it manually under:  
**S/W Management > CCU\_CCNF - Central Communication Unit (CCNF) > OTA Initialization (B).**

Follow the instructions on the screen.

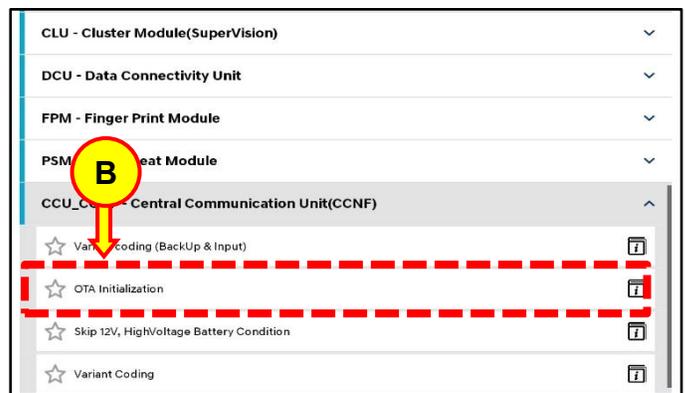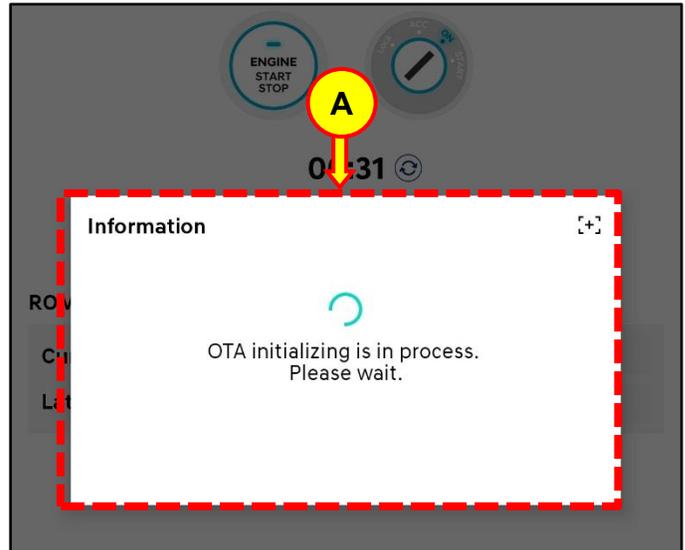

6.


**DIGITAL DOCUMENTATION**



Using the tablet or GDS screen capture function, take a screenshot of the ECU Update "Success" result screen.

Upload the photo to STUI.

**NOTE:** The VIN/Date/Time/Mileage photo imprint is **NOT** required for GDS screenshots.

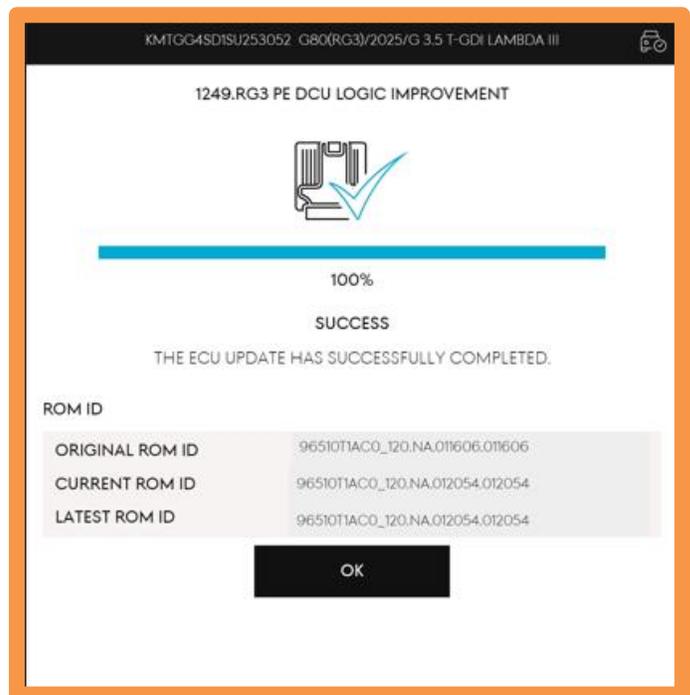

7. Perform an **All Systems Fault Code** search and erase DTC history that had incidentally occurred from the ECU update.



8. Start the engine to confirm proper operation of the vehicle.
9. The service procedure is now complete.

**NOTICE**

If the ECU update fails in Auto Mode, perform the update in Manual Mode using the password(s) below.

**Manual Mode Password:**

Event	ECU Menu	Password
1249	RG3 PE DCU 96510-T1AC0	9651