

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q5	2010 – 2017	All	Not applicable
A4, and S4	2010 – 2016		
Q7	2010 – 2015		
A4 Avant	2010 – 2012		
A8	2011 – 2017		
A6, and A7	2012 – 2018		
S6, and S7	2013 – 2018		
S8	2013 – 2017		
allroad	2013 - 2016		
Q5 hybrid	2013 – 2015		
RS 7	2014 – 2018		
SQ5	2014 – 2017		
A3, and S3	2015 – 2020		
A3 Cabriolet	2015 – 2019		
Q3	2015 – 2018		
A3 Sportback e-tron	2016 – 2018		
RS 3	2017 - 2020		

REVISION HISTORY

Revision	Date	Purpose
10	-	Revised title (Change to text) Revised header (Corrected model codes, model years and PR codes) Revised <i>Condition</i> (Change to text) Revised <i>Technical Background</i> (Change to text)

		Revised <i>Service</i> (Modify images, change to work process step order, change to text) Revised <i>Warranty</i> (Change to text) Revised <i>Required Parts and Tools</i> (Remove table, change to text)
9	02/06/2024	Revised header (Corrected model codes and model years, add PR codes) Revised <i>Warranty</i> (Updated SRTs and labor operations)
8	04/19/2021	Revised header (Added MY 2019 – 2020 A3 vehicles)

Customer states:

- Cracking noises from the roof area.
- **Only applies to large roof systems.**

Technical Background

Relative moments of the T-frame fasteners can cause noises.

Production Solution

Not applicable.

Service

1. The following materials are needed for repair.

Fabric adhesive tape: cut D 004 350 A2 to a length of 25 mm.

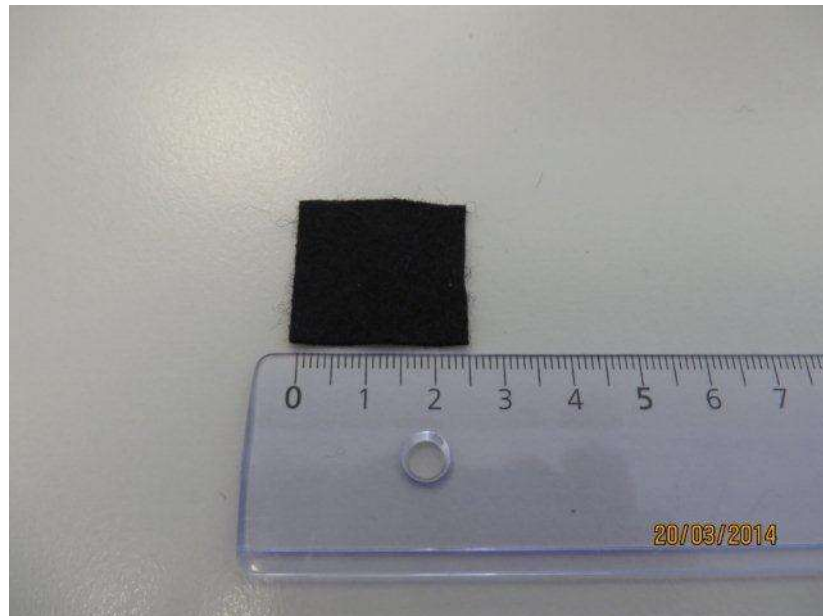


Figure 1. A 25mm section of fleece adhesive tape D 004350A2.

2. Lower the headliner and apply the fabric adhesive tape to the T-frame.

It is not necessary to remove the headliner (Figure 2).



Figure 2. Unclipping the T-frame.

3. Apply the fabric adhesive tape on all clip positions on the T-frame (Figures 3 - 4).



Figure 3. Fabric adhesive tape section applied.



Figure 4. Retaining clip isolated with the fabric adhesive tape.

Warranty

Claim Type:	<ul style="list-style-type: none"> If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	7084		
Damage Code:	0020		
Labor Operations:	A6:		
	Modify trim frame	7084 4999	130 TU
	A8:		
	Modify trim frame (Includes front and rear)	7084 4999	190 TU
	Q7:		
	Modify trim frame (Includes front and rear)	7084 4999	220 TU
	A4:		
	Modify trim frame	7084 4999	110 TU
	Q5:		
	Modify trim frame	7084 4999	160 TU
Q3:			
Modify trim frame	7084 4999	120 TU	

A3:		
Modify trim frame	7084 4999	110 TU
GFF	No allowance	0 TU
Claim Comment:	As per TSB 2038029/10	

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Fabric adhesive tape: **D 004 350 A2** with the quantity 0.1 (which is 1 m).

The specified part numbers were correct at the time of publication.

If there is now a newer part number available in ETKA, this part number must be used.

The exception to this is if the TSB explicitly states that only the specified part number must be used.

Additional Information

All part and service references provided in this TSB (**2038029**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.