

January 21, 2026

Version 1

Seat Belt Reminder System Not Operating Properly

APPLIES TO

Year	Model	Trim Level	VIN Range
2023–24	Pilot	ALL	ALL
2025	Pilot	ALL	5FNYG1...SB000001 thru 5FNYG1...SB180976

SYMPTOM

The seat belt reminder incorrectly indicates that the second-row right passenger seat belt is unfastened even after the passenger has fastened it.

POSSIBLE CAUSE

A damaged or broken wire inside the seat belt buckle assembly may cause the seat belt reminder to illuminate red or gray, after the seat belt has been fastened.

CORRECTIVE ACTION

Inspect the second-row right passenger seat belt buckle, replace the seat belt buckle assembly if necessary.

NOTE: Pilot will require the seat recline inner and outer trim covers to be replaced.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
8555A8	Inspect second-row right passenger seat belt buckle	0.2hr	01801	03217	A26027A	04863-T90-A01ZA
8551G4	Replace second-row right passenger seat belt buckle and inner/outer trim covers (Includes inspection)	1.4hr			A26027B	

PARTS INFORMATION

Part Name	Part Number	Quantity
Belt Assy, Inner R, Mid Seat	04863-T90-A02ZA	1
Cover Outer, Reclining Inner R	81354-TYA-A22ZA	1
Cover Inner, Reclining Inner R	81356-TYA-A22ZA	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

INSPECTION PROCEDURE

1. Confirm on the driver-information interface that the seat belt reminder illuminates red or grey when the second-row right passenger's seat belt is fastened:
 1. Turn the vehicle to the **ON** mode.
 2. Fasten the second-row right passenger seat belt.
 3. Does the seat belt reminder illuminate **RED** or **GRAY**?
 - **YES** - Proceed to REPAIR PROCEDURE.
 - **NO** - Wiggle and twist the fastened seat belt buckle assembly while checking the seat belt reminder.
 - If the seat belt reminder stays **GREEN**, no repair is needed. Continue with normal troubleshooting.
 - If the seat belt reminder flickers intermittently, proceed to REPAIR PROCEDURE.

Click here to view the video.

▶ PLAY VIDEO

Red



Gray



Green



REPAIR PROCEDURE

NOTICE

Replacement of the seat recline inner and outer trim covers is required. If the covers are not replaced, the repair is incomplete and may damage the new seat belt buckle wiring, leading to another failure of the seat belt reminder system.

1. Replace the second-row right passenger seat belt buckle assembly, and the seat recline inner and outer trim covers.
 - [Rear Seat Area - Second Row](#)
 - [Seat Recline Inner and Outer Trim](#)
2. Reinstall all removed parts in the reverse order of removal.