



**Date:** 30.01.2026      **Affected Models:** Emira 4-Cylinder Powertrain 2024 & 2025 Model Year Vehicles      **Affected Regions:** Federal Market      **Affected Volume:** 712      **Number:** 131-26004

Copy files should be maintained by:


Service Manager		Service Reception		Supervisor		Parts Manager	
-----------------	--	-------------------	--	------------	--	---------------	--

**TITLE**

Fitment of tail lamp link lead harnesses to prevent indicator warning message activation.

**REASON**

Under certain conditions the warning message shown to the right can be activated in the driver display when both the brake lamps and a turn signal are activated at the same time. The cause of this issue has been identified as the unique Federal rear lamp combined position/brake/turn indicator configuration.

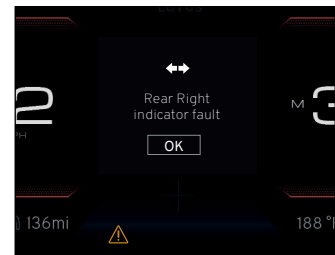

**NOTE:** Even with this message displayed, the tail lamp and turn signal should work as intended.

RCL link leads fitted between the engine compartment harness and rear lamp connector plugs are now fitted as a production running change to resolve this issue. These can also be ordered via the parts system on the Lotus Commercial Management System (LCMS) for 2024 - 2025 model year 4-cylinder vehicles.


Part Number	Description	Qty/Vehicle
8901537030	Bumper Federal RCL Link Lead	2

**ACTION**

- Check and identify any affected Emira vehicles from your inventory stock, dealer demonstrators and customer vehicles to ensure that this campaign action is performed at the first opportunity.
- Any affected vehicle's campaign status will be displayed in the warranty section of LCMS.

*Procedure:*


1. Remove both left and right-hand side rear wheelarch liners, refer to the Emira service notes, section 5 Exterior Trim > 27 Bumper and Valances > 533 12.01 Wheelarch Liners > Wheelarch liner - Rear - Left Side Replacement.
2. From the wheelarch area. pull the rear lamp to engine compartment harness connector mounting peg of from the subframe retaining stud (highlighted in orange).

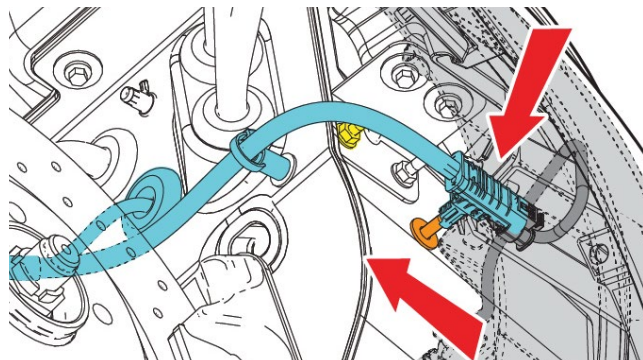

Continued...



3. Pull the rear lamp to engine compartment harness connector mounting peg of from the fender retaining stud.
4. Unplug the connectors
5. Fit the tail lamp link harness (8901537030) (highlighted in green), between the connectors.
6. Fit the mounting peg of the tail lamp link lead harness onto the subframe retaining stud (highlighted in orange).
7. Fit the mounting peg of the engine compartment harness connector onto the subframe/fender bracket stud (highlighted in yellow).

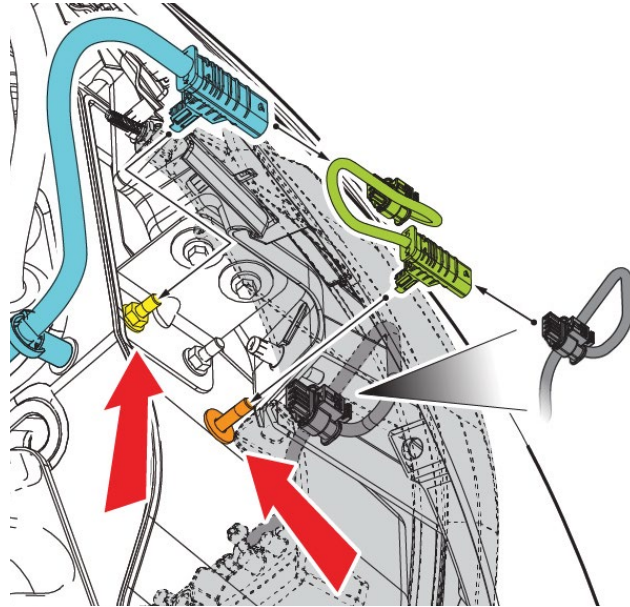

8. Repeat the procedure on the right-hand side rear tail lamp.
9. Put the vehicle into active or driving mode and activate the brake lamps and turn signals at the same time to ensure that the warning message does not appear in the driver display before refitting the wheelarch liners and rear wheels.

The Emira service notes are available to view from the Lotus Service Technical Information System (TIS).

#### Warranty Declaration

This technical service bulletin is not intended as a recall procedure, nor will it have an affect on the vehicles warranty period.

Please perform the Campaign Agreement in LCMS which can later be converted into a Warranty Claim having the warranty type "Recall and Campaign".

This shall be raised in LCMS in under campaign ID QBS-131-26004.

#### CHARGES

A warranty claim may be submitted on Lotus Commercial Management System (LCMS), campaign number QBS-131-26004.

1.8 hours labour time per vehicle, plus 2 x 8901537030 Bumper Federal RCL Link Lead, using operation code 17.11.39-06 using A code 27 and B code 38.

Ends.