

192/232 With Front Axle Lift Function – "Do Not Drive Over 50 MPH" Suspension Message in Instrument Cluster - C128763 & C128864

Topic number	LI32.34-P-080258
Version	1
Function group	32.34 - Anti roll governor (WR)
Date	2/9/26
Validity	Model series 192/232 with code 479
Reason for change	

Complaint

"Do Not Drive Over 50MPH" Suspension Message in Instrument Cluster

Possible DTC's in Quicktest:

C128763 in N51/1 - "The pressure control system has a malfunction. There is an implausible signal."

C128864 in N51/1 - "The level control system has a malfunction. The duration of the actuation was exceeded: over-load protection is active."

Note:

Only applies to vehicles up to production date October 15, 2025

Cause

Coding in the suspension control unit N51/1 (EHRC232).

Remedy

SCN code the suspension control unit N51/1 (EHRC232).

Verify no instrument cluster light illuminates when actuating the front axle lifter to the raised and lowered position.

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of ve-

hicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Chassis/suspension > Suspension/Dampening > Suspension System Function > Indicator lamp is on
Chassis/suspension > Suspension/Dampening > Roll control > Malfunction

Control unit/fault code	
Control unit	Fault text
N51/1 - Semi-active roll stabilization (Roll control) (EHRC232)	C128864 - The pressure control system has a malfunction. There is an implausible signal.
	C128763 - The level control system has a malfunction. The duration of the actuation was exceeded: overload protection is active.

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note