



Service Bulletin

Bulletin No.: PIT6482

Date: February, 2026

PRELIMINARY INFORMATION

Subject: A11 Radio Service Installation Instructions with UVB

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025 - 2026		All	All	All	All
Chevrolet	Equinox	2024 - 2026		All	All	All	All
Chevrolet	Equinox EV	2024 - 2026		All	All	All	All
Chevrolet	Traverse	2024 - 2026		All	All	All	All
GMC	Acadia	2024 - 2026		All	All	All	All
GMC	Terrain	2025 - 2026		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	IVE and UVB
Condition	During installation of an A11 Radio service part, the rear view camera may appear backwards if steps are not followed exactly.
Cause	Software anomaly in the radio

Correction

Note: There is no way to recover a vehicle that has this reversed camera issue if this procedure has not been followed.

When installing the A11 Radio, do NOT connect the X10 4-way white coax connector.

Continue with A11 Radio: Programming and Setup steps as normal, including repeating the programming until programming is blocked.

Connect the X10 4-way white coax connector at the A11 Radio.

Confirm that the rear view camera is showing properly on the screen.

Version	1
Modified	02/04/2026 Created On

