



Service Bulletin

Bulletin No.: PIT6483

Date: February, 2026

PRELIMINARY INFORMATION

Subject: IPC Gauges Drop Out / Flicker / Sweep / Several Warning Messages / Low Speed Lan DTC U0078 U0140

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2015-2020		All	All	All	All
Cadillac	Escalade ESV	2015-2020		All	All	All	All
Chevrolet	Silverado 1500	2014-2021		All	All	All	All
Chevrolet	Silverado 1500 LTD (RPO J21, VIN Digit 5 = W or Y)	2022		All	All	All	All
Chevrolet	Silverado 2500	2015-2023		All	All	All	All
Chevrolet	Silverado 3500	2015-2023		All	All	All	All
Chevrolet	Suburban	2015-2020		All	All	All	All
Chevrolet	Tahoe	2015-2020		All	All	All	All
GMC	Sierra 1500	2014-2021		All	All	All	All
GMC	Sierra 1500 Limited (RPO J21, VIN Digit 5 = 8 or 9)	2022		All	All	All	All
GMC	Sierra 2500	2015-2023		All	All	All	All
GMC	Sierra 3500	2015-2023		All	All	All	All
GMC	Yukon	2015-2020		All	All	All	All
GMC	Yukon XL	2015-2020		All	All	All	All

Involved Region or Country	North America
Condition	<p>Some customers may report one or more of the following concerns:</p> <ul style="list-style-type: none"> • IPC gauges flicker, jump, drop out, or sweep • Multiple IPC warning messages or indicators, such as: <ul style="list-style-type: none"> - Service Stabilitrak - Service Side Object Detection - Service Steering Column - Service Park Assist - Service Trailer Brake System - Service Tire Pressure Monitoring System

	<ul style="list-style-type: none"> - Service Restraint System • IPC PRNDL display intermittently turning on and off • Headlamps, exterior lighting, and/or interior backlighting cycling on and off • Backup/Reverse camera image appears fuzzy <p>These symptoms typically occur within the first minute after starting the vehicle. In some cases, there may or may not be a correlation with the headlamps being turned on or off.</p> <p>In all cases, multiple modules will set DTC U0140 (Loss of Communication with BCM). Additional DTCs that may or may not be present include: U0078, B2575, B2699, B3135, B3883, U0151, U0155, U0170, B3130, or other low-speed LAN communication-related DTCs.</p>
<p>Cause</p>	<p>These conditions may be caused by the installation of aftermarket LED headlamps. Due to the wide variety of aftermarket LED headlamp designs, the example shown below is provided for reference only.</p>



7074045

Correction

Disconnect the aftermarket headlamps and retest the vehicle. If normal operation is restored, install the original factory light bulbs.

Warranty Information

Concerns caused by aftermarket devices are not covered under warranty and any repairs are the customer's responsibility.

<p>Version</p>	<p>1</p>
<p>Modified</p>	<p>02/04/2026 Created on</p>

