



Service Bulletin

Bulletin No.: PIP6101

Date: February, 2026

PRELIMINARY INFORMATION

Subject: L3B LK0 Tick Noise Soft Lash Adjuster

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025 - 2026		All	All	2.5 LK0	All
Chevrolet	Colorado	2025-2026		All	All	2.7 L3B	All
Chevrolet	Traverse	2025-2026		All	All	2.5 LK0	All
Chevrolet	Silverado 1500	2025-2026		All	All	2.7 L3B	All
GMC	Acadia	2025-2026		All	All	2.5 LK0	All
GMC	Canyon	2025-2026		All	All	2.7 L3B	All
GMC	Sierra 1500	2025-2026		All	All	2.7 L3B	All

Involved Region or Country	North America
Condition	Top End Ticking Noise.
Cause	Manufacturing debris inside the Stationary Hydraulic Lash Adjuster (SHLA) and not allowing it to pump up with oil, resulting in a soft lash adjuster.

Correction

Verify the ticking noise is from the valvetrain area by using a stethoscope or other methods.

Remove the camshaft carrier and inspect for soft stationary hydraulic lash adjusters by pushing down on each of the followers / rocker arms where it rests on the lash adjusters / SHLA.

Check all of them on intake and exhaust sides.

Replace any soft lash adjusters and the follower it operates.

The video below is an example of a stationary hydraulic lash adjuster / SHLA that is soft .

Parts Information

Description	Part Number	Qty
Adjuster, Hydraulic Valve Lash	See Parts Catalog	As Needed
Arm, Exhaust Valve Rocker	See Parts Catalog	As Needed
Arm, Intake Valve Rocker	See Parts Catalog	As Needed

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4061270	Hydraulic Valve Lash Adjuster Replacement	Use Appropriate Time For Application

Version	1
Modified	02/06/2026 - Created on