



## STAR ONLINE PUBLICATION



**Case Number:** S2523000044 Rev. A

**Release Date:** February 2026

**Symptom/Vehicle Issue:** Whistling Noise From Left Side Exterior Mirror Area While Driving.

**Models Affected:** 2024-2026 Ram 1500 (DT)

**Customer Complaint/Technician Observation:** Wind noise or whistle noise heard from the driver's door area above typically 65 mph.

**Discussion:** If the customer complains of wind noise or whistle on the driver side, the mirror temperature sensor access cover could be the root cause. The noise can be isolated by taping over the access cover seams and test driving to duplicate. If after taping the noise is eliminated, replace the access door. The temperature sensor access door is serviceable and should be the only component replaced. Do not replace the mirror assembly. A revised driver's mirror mounted ambient sensor access cover is being released to improve wind noise complaints. Use STARParts to verify proper application. Revised part numbers are 68744863AB and 68744861AB.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.**