

REFERENCE:	TSB: 08-050-26 GROUP: 08 - Electrical	Date:	February 7, 2026	REVISION:	—
VEHICLES AFFECTED:	2026 (WL) Jeep Grand Cherokee / Grand Cherokee L This bulletin applies to vehicles built on or before February 03, 2026 (MDH 0203XX) equipped with 2.0L Hurricane 4 Turbo Turbo w/ESS (Sales Code EC7) and Passive Entry-FRT Doors, Liftgate (Sales Code GXD).			MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> CH NOTE: This bulletin applies to the North American market.	
CUSTOMER SYMPTOM:	Customers may experience the following: <ul style="list-style-type: none"> • Keyless Ignition Node (KIN) stays illuminated after vehicle ignition is OFF. • Depleted battery. <p align="center">NOTE: Battery depleted due to a 100mA ignition-off draw.</p>				
CAUSE:	PROXI configuration alignment				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-028, date of issue February 07, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves performing a PROXI alignment to the RFHM.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
18-19-02-JN	Perform PROXI Configuration Alignment (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	ZY	Service Action	

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles on the RSU VIN list.**

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	–	–

REPAIR PROCEDURE:

1. Using the wiTECH, perform the PROXI Configuration Alignment routine to the RFHM. This routine is available under the 'Guided Diagnostics' tab found on the home, 'Vehicle View' page of wiTECH.

NOTE: The PROXI Configuration Alignment routine will cause two DTCs to set:

- **B259C-13 - Rear Left Door Handle Sense-Circuit Open.**
- **B259D-13 - Rear Right Door Handle Sense-Circuit Open.**

This is a known and expected configuration issue. Do NOT replace the RFHM, the rear door handles or change the PROXI configuration. There is no functional impact to the customer and no hardware components are faulty.

2. Clear any DTCs that may have set (except the two DTCs listed above).

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.