

**ATTENTION:** Mercedes-Benz Dealer Principals, General Managers, Sales Managers, Service Managers & Parts Managers

## Service Campaign Notification

February 13, 2026

### Replace TIREFIT Bottle in Trunk – Amendment 1

Campaign #

Description

2025090001

25P5898016

### Campaign Details

<b>Total Population</b>	151	<b>Model(s)/ Platform(s)</b>	A-Class, C-Class, CLA, E-Class, EQB, GLA, GLB, and GLC, GLE (177, 205, 206, 118, 213, 214, 243, 247, 253, and 167 platform)
<b>Model Year(s)</b>	2015-2025		
<b>Issue</b>	Mercedes-Benz AG, the manufacturer of Mercedes-Benz vehicles, has determined that on certain subject vehicles, the TIREFIT sealant bottle may not meet specifications. The possibility exists that the sealant bottle may leak or may have otherwise been removed from the vehicle.		
<b>Remedy</b>	MBUSA will conduct a service campaign. An authorized Mercedes-Benz dealer will replace the TIREFIT bottle in the trunk.		
<b>Launch Date</b>	Affected VINs will be flagged as “OPEN” in VMI on Friday, February 13, 2026.		
<b>Warranty Claim Notice</b>	Please note the campaign will close after the warranty claim has been submitted. This change can take at least one-day to reflect in NetStar VMI.		

While we regret any inconvenience this may cause, MBUSA is determined to maintain a high level of vehicle quality and customer satisfaction. Please refer all customer inquiries to the Customer Care Center at 1-800-FOR-MERCEDES.



# Service Campaign Bulletin



February 2026

TO: ALL MERCEDES-BENZ DEALERS

CAMPAIGN NO.	2025090001
CAMPAIGN DESC.	25P5898016
SUBJECT	Replace TIREFIT Bottle in Trunk – Amendment 1
MODEL(S)	A-Class, C-Class, CLA, E-Class, EQB, GLA, GLB, GLC and GLE (177, 205, 206, 118, 213, 214, 243, 247, 253 and 167 platform)
MODEL YEAR(S)	2015 – 2025
CAMPAIGN POPULATION	151

## Campaign Technical Instructions

### Prior to performing this Campaign:

Check the Vehicle Master Inquiry (VMI) to verify this campaign applies to the specific vehicle.

1. Always check for other open campaigns and perform them accordingly!
2. Review the entire campaign bulletin first, and perform the procedures exactly as described.

Order No. P-SC-2025090001

# Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

### Primary Parts Information

Qty.	Part Name	Part Number
As required (1)	Tire sealant bottle including hose	A 000 583 75 05 28 *
As required (1)	Tire sealant bottle including hose	A 000 583 76 05 28 *

\* The replacement parts must be determined according to the equipment variant for the vehicle identification number via the parts process in the XENTRY Portal.

**i** Small parts such as screws, lock nuts, sealing rings, cable ties, fluids, sealant, etc. are not listed in the parts list. Any small parts required should be claimed as needed according to XENTRY Parts Information.

### Check/Test Procedure

1. Check manufacturer of tire sealant bottle.

**i** In the case of tire sealant bottles from “Aircom” (Figure 1), the **expiration date** (Figure 2) must be checked.

**i** If the **expiration date** is “2029-01,” “2029-12,” “2030-01,” or “2030-02,” the tire sealant bottle must be replaced.



Figure 1



Figure 2 (OK)

- a. Tire sealant bottle is **not** from “Aircom”:
  - **No further action required, end measure.**
- b. Tire sealant bottle is from "Aircom" with **expiration date** “2029-01,” “2029-12,” “2030-01” or “2030-02”:
  - Perform **Work Procedure**.

**Work Procedure**

1. Remove TIREFIT tire sealant bottle from vehicle.  
i For basic data, see **AP40.10-P-4054R**.
2. Clean contaminated surfaces and objects so they are free of residue.  
i Replace any components that cannot be cleaned.  
i Capture pictures of components that cannot be cleaned and submit with warranty claim.
3. Insert new TIREFIT tire sealant bottle in vehicle holder.

**Warranty Information**

i **Note:** *The following allowable labor operation should be used when submitting a warranty claim for this repair:*

Damage Code	Operation Number	Description	Labor Time (hrs.)
58 980 16	11-0055	Check TIREFIT tire sealant bottle	0.1
	11-0010	Replace TIREFIT tire sealant bottle	0.1
	11-0011	Perform cleaning in trunk (after check) <b>Includes:</b> Replace components as needed.	ZM

i **Note:** *Always check XENTRY Operation Time (XOT) for the current OP-Code times. Labor times are subject to change and updates may not be reflected in this document.*