



Service Bulletin

Bulletin No.: PIC6643

Date: February, 2026

PRELIMINARY INFORMATION

Subject: Front Turn Signal Flash Fast and/or Check Front Turn Signal Message

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT4	2024	2025	All		All	All

Involved Region or Country	North America
Condition	Customer's may comment that they are intermittently experiencing one or both front turn signals flashing fast and/or a check front turn signal message. Condition is more frequent when operated in cold ambient temperatures less than 25 degrees F (-4 degrees C) or colder.
Cause	Internal Headlamp Issue

Correction

To verify the customer's complaint, park the vehicle outside, with ambient temperatures less than 25 degrees F (-4 degrees C) or colder, for an extended period of time.

If one or both front turn signals flash fast, replace the affected headlamp assembly.

Note: For additional testing, the technician can swap the headlamp assemblies from one side to the other and see if the fault follows the headlamp assembly.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2040510	Front Headlamp Replacement	Use Standard Published Labor Times

Version	1
Modified	02/12/2026 — cREATED.

