

REFERENCE:	TSB: 23-003-26 GROUP: 23 - Body	Date:	February 12, 2026	REVISION:	-
VEHICLES AFFECTED:	2025 (KM) Jeep Wagoneer S This bulletin applies to vehicles built on or after August 13, 2024 (MDH 0813XX) and on or before February 23, 2025 (MDH 0223XX) equipped with 400V G2500 FR/RR Elec Drive Motors (Sales Code ELD).			MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> CH <input type="checkbox"/> EE <input type="checkbox"/> IAP <input type="checkbox"/> SA <input type="checkbox"/> MEA NOTE: This bulletin applies to North America markets.	
CUSTOMER SYMPTOM:	The customer may comment on one or more of the following: <ul style="list-style-type: none"> • All door trim panels have the wrong applique installed. • Right front door has the wrong memory seat switch closeout bezel installed. 				
CAUSE:	Improperly built door panels due to lack of correct materials				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-030, date of issue February 12, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves replacing applique on all door panels and the front right door panel closeout bezel.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
23-20-22-94	Replace All Four Door Trim Panel Appliques and Right Front Door Memory Seat Switch Bezel (0 - Introduction)	6 - Electrical and Body Systems	0.7 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	7TJ48DX8AA	Bezel, Closeout	Right Front Door Only
1 (AR)	7LT91AAAAB	Applique, Door Panel	Front Left Trim Code -XB or -X7
1 (AR)	7LT90AAAAB	Applique, Door Panel	Front Right Trim Code -XB or -X7
1 (AR)	7LT93AAAAB	Applique, Door Panel	Rear Left Trim Code -XB or -X7
1 (AR)	7LT92AAAAB	Applique, Door Panel	Rear Right Trim Code -XB or -X7

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	-	-

REPAIR PROCEDURE:

1. Remove both front door trim panels. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 23 - Body / Doors - Front / Panel, Door Trim / Removal.
2. Remove nine screws securing the door applique to the door panel assembly for both front doors [Fig. 1](#).

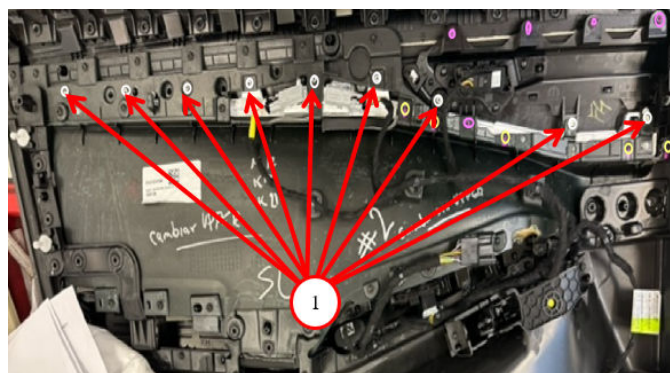


Fig. 1
Door Applique Screws

1 - Door Applique Screws

3. Remove and **DISCARD** both front door panel appliques.
4. Remove five LED light bar screws on the right front door panel [Fig. 2](#).

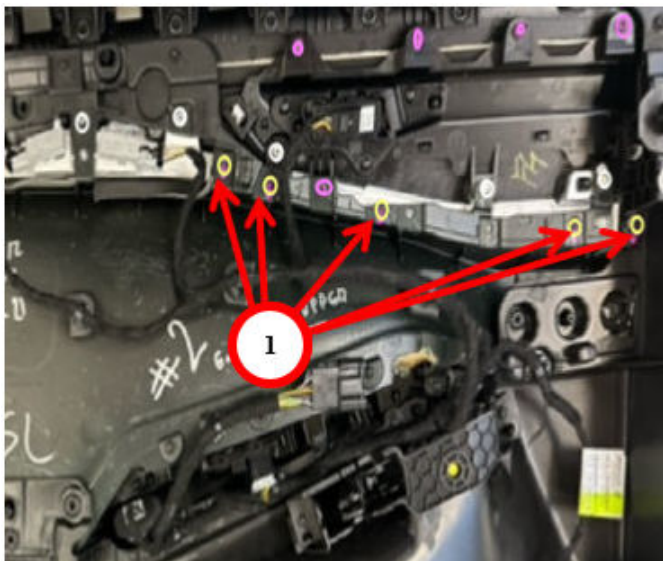


Fig. 2
LED Light Bar Screws

1 - LED Light Bar Screws

5. Remove five screws securing the closeout bezel to the right front door panel [Fig. 3](#).

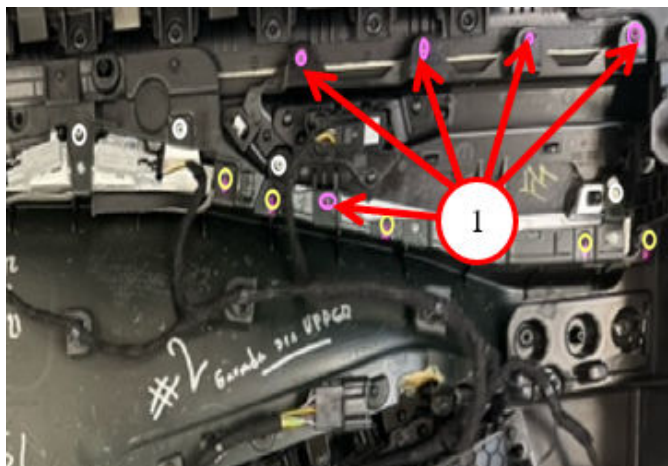


Fig. 3
Remove The Closeout Bezel

1 - Closeout Bezel Screws

6. Remove and **DISCARD** the right front door closeout bezel. Keep the memory seat switch.
7. Transfer the memory seat switch to the new closeout bezel.
8. Install the **NEW** right front door closeout bezel to the right front door trim assembly and secure using five screws [Fig. 3](#).
9. Install five screws securing the LED light bar to the right front door panel [Fig. 2](#).
10. Install a **NEW** door applique to both front door trim panels and secure using nine screws [Fig. 1](#).
11. Install both front door panels. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 23 - Body / Doors - Front / Panel, Door Trim / Installation.
12. Remove both rear door trim panels. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 23 - Body / Doors - Rear / Panel, Door Trim / Removal.

13. Remove ten screws securing the door applique to the rear door panel for both rear doors [Fig. 4](#).

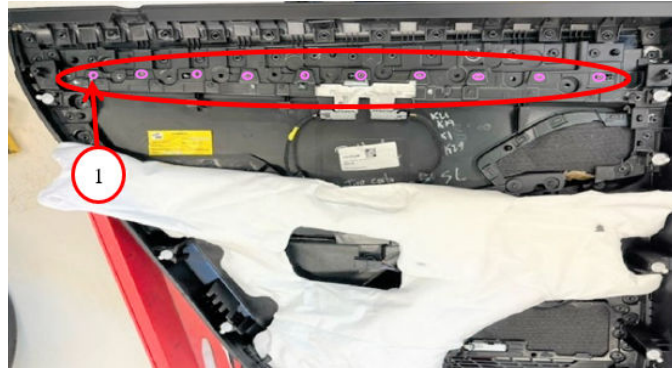


Fig. 4
Rear Door Applique Screws

1 - Remove Door Panel Applique Screws

14. Remove and **DISCARD** the door applique for both rear doors.

15. Install a **NEW** door applique to each rear door panel and secure using ten screws [Fig. 4](#).

16. Install both rear door trim panels. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 23 - Body / Doors - Rear / Panel, Door Trim / Installation.

17. Clear DTCs.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.