



Service Bulletin

Bulletin No.: PIT6477B


Date: February, 2026

PRELIMINARY INFORMATION

Subject: Unable to Perform GDS2 Automated Bleed After Master Cylinder Replacement

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2026		ALL	ALL	ALL	ALL
Cadillac	Escalade ESV	2026		ALL	ALL	ALL	ALL
Chevrolet	Suburban	2026		ALL	ALL	ALL	ALL
Chevrolet	Tahoe	2026		ALL	ALL	ALL	ALL
GMC	Yukon	2026		ALL	ALL	ALL	ALL
GMC	Yukon XL	2026		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Condition	Some Technicians may notice that they get an error screen when trying to perform the automated bleed after master cylinder replacement, (See Error Screen Below).
Cause	Software Anomaly with GDS2 Software.

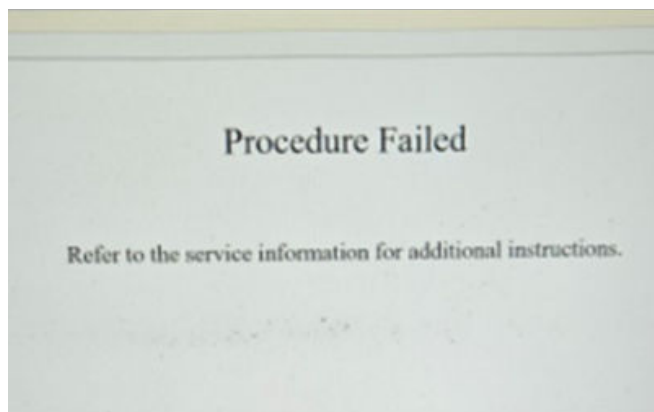

7058016

Correction

An updated version of GDS2 has been released to address this issue. Please launch Techline Connect (TLC) and verify that GDS2 is updated to version v2026.02.12 or later.

When performing the GDS2 Auto Brake Bleed procedure, you will now see two options: "Automated Brake Bleed" and "Modified Automated Brake Bleed."

Begin by selecting "Automated Brake Bleed." If the procedure completes successfully, no further action is required.

If the "Automated Brake Bleed" procedure does not complete successfully, proceed with "Modified Automated Brake Bleed," which incorporates the updated fix.

Additional SI Keywords

C0597

Version	3
Modified	01/26/2026- Created on 01/30/2026- Updated to add additional note to correction field 02/17/2026-Updated to add the repair procedure

