



Service Bulletin

Bulletin No.: PIT6458A

Date: February, 2026

PRELIMINARY INFORMATION

Subject: Dead Battery Due To A Battery Draw

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025-2026		All	All	All	All
Chevrolet	Colorado	2023-2026		All	All	All	All
Chevrolet	Equinox	2025-2026		All	All	All	All
Chevrolet	Traverse	2024-2026		All	All	LKO	All
GMC	Acadia	2024-2026		All	All	All	All
GMC	Canyon	2023-2026		All	All	All	All
GMC	Terrain	2025-2026		All	All	All	All

Involved Region or Country	North America
Condition	A vehicle may be towed in with a dead battery or a customer may complain of a no crank no start that required a jump start. Upon diagnosis an excessive battery draw may be found.
Cause	A coin may be lodged under one of the window switches in the driver/master window switch.

Correction

Inspect all window switches for a coin lodged under one of the buttons.

This will be visible and will not require any removal or disassembly of the window switch.

If a coin is found, remove the lodged coin.

Educate the customer of this condition and encourage them that coins should be stored away from the window switch.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5481018*	Lodged Coin Removal- This is to be used in addition to diagnostic time, not instead of it.	0.2 Hr.
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	12/04/2025 – Created. 2/29/26 — Updated Correction

