



**SSM 54595 2025 Maverick/Corsair, 2025-2026 Escape/Bronco Sport – 8F35
Transmission - Will Not Shift Out Of Park (P) And Illuminated Powertrain
Malfunction (Wrench) Indicator With DTCs P07E6, P0760, P0761, P2706, P2707
And/Or P2702 - Built On 01-Sep-2024 And Through 15-Sep-2025**

Some 2025 Maverick/Corsair and 2025-2026 Escape/Bronco Sport vehicles equipped with an 8F35 transmission and built on 01-Sep-2024 and through 15-Sep-2025 may exhibit a condition where the vehicle will not shift out of Park (P) and exhibit an illuminated powertrain malfunction (wrench) indicator with diagnostic trouble codes (DTC) P07E6, P0760, P0761, P2706, P2707 and/or P2702 stored in the powertrain control module (PCM). To correct the condition, replace the main control valve body. Refer to Workshop Manual (WSM), Section 307-01. For claiming, use causal part 7A100 and labor operations 7001D and 7001D14.