



SIB 71 01 26

DELIVERY STOP: VIN LABEL

2026-02-23

This Service Information Bulletin (Revision 1) replaces SI B71 01 26 dated February 13, 2026

**What's New** (Specific text highlighted):

- Cause added
- Correction added
- Procedure added
- Parts Information added
- Claim Information added
- Attachment added

<input type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
<input type="checkbox"/>	THIS REPAIR IS REMOTE SOFTWARE UPGRADE (RSU) FRIENDLY

**MODEL**

E-Series	Model Description	Production Date
G07	BMW ALPINA XB7 Sports Activity Vehicle	August 1, 2025 – January 17, 2026

**SITUATION**

BMW AG has issued a Delivery Stop (effective February 13, 2026) on certain Model Year 2026 BMW vehicles that were produced between August 1, 2025, and January 17, 2026.

**Do not deliver to a customer, as New, Certified Pre-Owned, or Used, a vehicle that is subject to a Delivery Stop until the vehicle is repaired. Do not use or sell replacement equipment/parts subject to a Delivery Stop.**

**CAUSE**

On G07 vehicles, the VIN-specific type plate (aka Manufacturer's certification placard/label) on the driver's B-pillar has missing information. Instead of displaying the correct maximum permissible rear axle load (GAWR) in American pounds (lbs), the type plate shows two horizontal lines (circled).

The correct maximum permissible axle load is 4123 lbs.


**CORRECTION**

Replace the type plate on the lower B-Pillar.

**PROCEDURE**



1. Remove the type plate from the driver-side B-pillar (circled). Light heat may be needed.
2. Remove all adhesive residue using a suitable cleaner.
3. Apply activator 205 thinly and sparingly in area of type plate.
4. Allow 2 minutes of drying time.

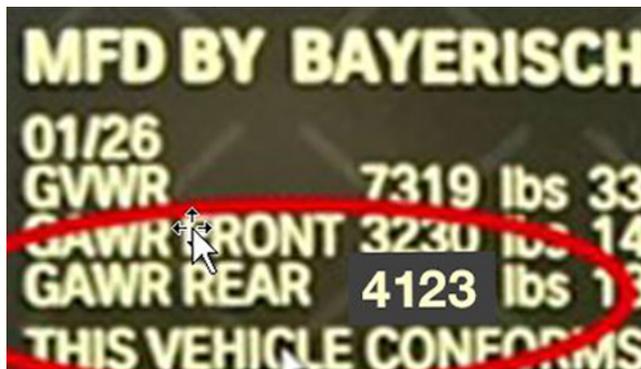

5. Attach the new type plate with the correct GAWR of 4123 lbs, using the same positioning as the original.
  - Press firmly over the entire surface for maximum adhesion

**PARTS INFORMATION**

Only use and invoice the part numbers below.

Performing a part number look-up in ETK in place of using/invoicing the following part numbers may result with the wrong part numbers being invoiced and installed.

Please be aware all VIN and TIRE label requests (refer to Attachment for reference) must be submitted to Coded Parts via IDS with the completed forms. The path is: **Create ticket > Parts Logistics > Coded Parts RDC > Coded Parts RDC.**

Part Number	Description	Quantity
07 14 7 320 729	Manufacturer Certification (B-Pillar VIN)	1
83 19 0 030 155	Activator 205 (DN = 250 mL)	1

**CLAIM INFORMATION**

Reimbursement for this Action will be via normal claim entry utilizing the applicable work package information below and the part number listed above

<b>Repair Code:</b>	<b>0071470300</b>	---
---------------------	-------------------	-----

Below are the special flat rate labor operation code choices for this action.

**Completion before the first vehicle delivery to a customer (New in-stock/No in-service date), or the**  
 © 2026 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED

Work Package	Labor Operation	Description (Plusposition)	Labor Allowance
# 1	00 79 680	Replace type plate	2 FRU

Or:

**The vehicle arrives at your center, and this Action shows open (No other Main work will be performed or claimed during this workshop visit).**

Work Package	Labor Operation	Description (Main work)	Labor Allowance
# 2	00 79 140	Replace type plate	3 FRU

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

### Claim Repair Comments

Reference the SIB number, the issue (briefly), and the work package (WP) number performed in the technician's RO notes, and in the claim comments (For example: B71 01 26 Replace the vehicle information type plate WP 1), unless otherwise required by State law.

### Sublet – Bulk Supply Materials (RO and Claim Comments Required)

<b>Sublet Code 4</b>	Reimbursement for the repair-related bulk supply materials (Do not use the BMW part numbers for claim submission)	Up to \$1.00
----------------------	--	--------------

Sublet reimbursement calculation for claiming the applicable repair-related bulk supply materials (BMW part numbers) is at the dealer net (DN) price for the proportional quantities used plus your center's handling.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section.

### FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

### Supporting Materials

[picture\\_as\\_pdf B710126 Attachment VIN\\_Label\\_Request\\_Form.pdf](#)

