

Advanced Technical Information

Bulletin #: 2533.1

Part ID: 5587

5

XAB – Macan Rear Lid Does Not Open/Close

Vehicles Affected

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Macan BEV	As of 2024 up to 2026	XAB	N/A	N/A

Revision History

Revision	Release Date	Changes
0	January 5, 2026	Original document
1	February 10, 2026	Update to service information

Condition

The customer states the rear lid does not fully close or does not open. In these cases, the rear lid can remain closed, remain slightly open, or begin to reopen while emitting a warning sound even if there is no obstruction.


Technical Background

The condition described above can occur if the opening lever spring in the latch is not seated properly. This may result in the latch remaining in the locked position, which could prevent latching at the striker.

Service Information

In these cases, check the latch for the rear lid for an indicator of version 06S or greater. If the part has a version from before 06S order a new latch. Once the part is received and the version is verified, replace the latch for the rear lid.

How to check the version for the latch:

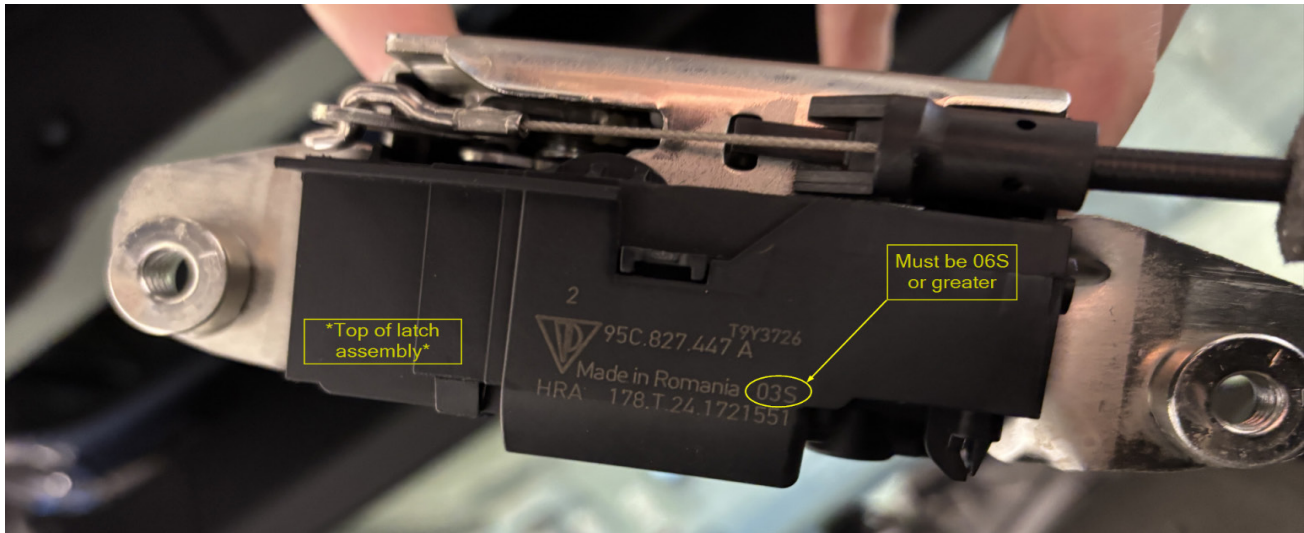

Warranty

For documentation and warranty invoicing, enter the working position and PCSS encryption specified below in the warranty claim:

APOS	Labor operation	I No.
55871900	Upper part of rear lid lock remove and reinstall (Main work)	

PCSS encryption:

Location (FES5)	55870	Upper part of rear lid lock
Damage type (SA4)	1711	Stiff, stuck, too little play

Search Items

Macan, Rear Lid, Striker Plate, Trunk Lid, XAB, Tailgate

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.