

Charging Socket (Motor Locking Mechanism) for Detecting Plug Defects - Locking Issues With the Charging Plug During Charging (SY 82/25)

Change overview

Release	Date	Change
0	09/30/2025	▪ First publication
1	01/22/2026	▪ Update of Part Number
2	02/27/2026	▪ Update of Part Number

Model Line: **Macan (XAB)**

Model Year: **As of 2024 up to 2025**

Concerns: **Charging socket (motor locking mechanism)**

Symptom: **The customer complains about locking issues with the charging plug in the charging socket during charging. The PIN for locking the charging plug does not extend.**

In addition, fault memory entries in relation to locking the charging plug can be stored.

Remedial Action: If there is a customer complaint, replace the motor locking mechanism of the affected charging socket with an optimized component status.

Date of Introduction: From 06/23/2025, or from chassis number WP1ZZXA8SL179112, the charging socket (motor locking mechanism) with optimized component status will be used in production.

Required parts

Parts Info:	Part No.	Designation – Location of use	Quantity
	PAD915651B	⇒ Actuator for high-voltage charging plug lock – Charging socket	1 piece

Required tools

- Tools:
- **P90999 - PIWIS Tester 4**
 - Battery charger with a current rating of **at least 90 A**, e.g. **VAS 5908 - battery charger 90A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '2X00IN Battery trickle charge'*

- Torque wrench, 0.4-2 Nm (0.3-1.5 ftlb.), e.g., **VAS 6253A - torque wrench, 0.4-2 Nm (0.3-1.5 ftlb.)**
- Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g., **V.A.G 1783 - torque wrench, 2-10 Nm (1.5-7.5 ftlb.)**
- Torque wrench, 6-50 Nm (4.5-37 ftlb.), e.g., **V.A.G 1331A - torque wrench, 6-50 Nm (4.5-37 ftlb.)**
- **VAS 6266A - Wheel fitting trolley**
- **VAS 1978/1A - Crimping pliers**
- **VAS 6558A - High-voltage measuring module**
- **VAS 6558A/45 - High-voltage measurement adapter**
- **VAS 6558A/46 - High-voltage measurement adapter**
- **VAS 6558/10-1A - High-voltage test adapter**
- **VAS 6558/10-2 - High-voltage test adapter**
- **T40262 - Locking cap**

Replacing charging socket (motor locking mechanism)

Work Procedure: 1 Replace charging socket (motor locking mechanism) of the affected charging socket.
 Charging socket 1: ⇒ *Workshop Manual '935655 Replace charging socket 1 (locking-mechanism motor)'*
or
 Charging socket 2: ⇒ *Workshop Manual '935655 Replacing charging socket 2 (locking-mechanism motor)'*

Labor position and PCSS encryption

Labor position:

APOS	Labor operation	I No.
93565505	Replace charging socket 1 (locking-mechanism motor)	
93565506	Replacing charging socket 2 (locking-mechanism motor)	

PCSS encryption:

Location (FES5)	93560	Charging socket
Damage type (SA4)	1611	not working

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.