

WST1 Workshop Campaign- Checking Front Left Level Sensor With Linkage and Replacing if Necessary

WST1 Workshop Campaign- Checking Front Left Level Sensor With Linkage and Replacing if Necessary

ID Number	WST1
Model(s)	Taycan (Y1A) Taycan Sport Turismo (Y1C)
Model Year(s)	2020 - 2022
Number of Affected Vehicles	489
VIN List	Attached below
Issue Description	<p>On the affected vehicles, there is the possibility that a holder of the front left level sensor was installed without corresponding surface protection. Corrosion can occur on this holder over the service life and a faulty vehicle level if the holder is broken. For this reason, the front left level sensor holder must be checked and replaced if necessary.</p>
What should Porsche Centers do?	<p>Please arrange for the measure to be carried out on affected vehicles as soon as possible.</p> <p>As of the time of this posting (2/4/2026) the remedy is immediately available.</p>
Parts Status	<p>Status 2 - PRMS Parts support ticket needed for release.</p> <p>NOTE: The ticket MUST have a photo attached of the corroded level sensor holder. Please see the TI for an example.</p>
TI	WST1

Required parts

No parts are required for checking the Level sensor.

If the result of the check is negative, the following part is required:

9J1616213	Level sensor with linkage (left)	1 piece(s)	No
-----------	-------------------------------------	------------	----

*The parts must be stored until **such time as the related warranty or campaign claim** has been credited. If a **barcode is generated** with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

Warranty processing

Validity:

This workshop campaign will be carried out up to December 4th, 2030 and will be closed on that date.

Please note that warranty claims can only be processed up to this date.

Scope 1:

Damage number	WST1 66 000
Repair Code	1
Labor time	13 TU

Scope 2:

- For vehicles with LED headlights (8BM/8IS)

Damage number	WST1 66 000
Repair Code	2
Labor time	109 TU

Scope 3:

- For vehicles with LED matrix headlights (8IU/8JU)

Damage number	WST1 66 000
Repair Code	2
Labor time	121 TU

Please enter the campaign carried out in the Warranty and Maintenance booklet for the vehicle.

Attachments

1. [VIN_List_Report_WST1_2026-02-04_V4.xlsx](#)

