

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: FRONT INNER BRAKE PAD PREMATURE WEAR	Bulletin No.: 04-001/26
	Last Issued : 02/10/2026

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
04-001/25	02/06/25

APPLICABLE MODEL(S)/VINS

2023-2025 CX-50 (All) with VINS lower than 7MMVA*****364431 (produced before April 26, 2025)

DESCRIPTION

Some vehicles may experience the front inner brake pads wear out faster than the outside. This accelerated pad wear may be caused by dirt and sand easily adhering to the inner friction surface of the disc while driving. To eliminate this concern, the shape of the dust cover and the front brake pad chamfer shape have been changed.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the brake pads and both dust covers with modified ones following the instructions in MGS.
 - CX-50 (WHEEL HUB, STEERING KNUCKLE REMOVAL/INSTALLATION)
 - CX-50 Hybrid (WHEEL HUB, STEERING KNUCKLE REMOVAL/INSTALLATION)
3. Verify the repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
D69R-33-261	Cover, Dust, Front RH	1	
D69R-33-271	Cover, Dust, Front LH	1	
D651-33-042A	Nut	2	[R]
T060-26-169A	Pin Snap	2	[R]
VAY0-33-28ZA	Pad Sub Set, Front Caliper	1	Non-Hybrid
VCY7-33-28ZA	Pad Sub Set, Front Caliper	1	Hybrid

[R]: Replacement parts

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	94
Damage Code	9C
Part Number Main Cause	7777-SP-Z05
Quantity	0
Operation Number / Labor Hours:	XXWZKXRX / 1.0 Hrs.

NOTE: Claim all parts as related parts.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.