

**February 23, 2026**

Version 1

## Product Update: 2023-25 Accord TCU OTA Software Update for Data Sharing

### APPLIES TO

Year	Model	Trim Level	VIN Range
2023–25	Accord	ALL	Check VIN status in iN for eligibility.

### BACKGROUND

Due to a software programming issue of the Telematics Control Unit (TCU, also referred to as TSU), certain functions may not operate as designed when accessed from the Screen Audio display. This condition results in an error message being displayed on the screen indicating "Setting Update Failure" when customers attempt to change certain settings.

### CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this product update.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. Repair these vehicles before they are sold.

### CORRECTIVE ACTION

Update the Telematics software.

### WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0105C9	Update TSU software	0.3 hr	6NL00	FNI00	A26037A	8B100-30A-A74

### PARTS INFORMATION

None.

### TOOL INFORMATION

None.

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

## SOFTWARE INFORMATION

Before beginning the repair, make sure all diagnostic and reprogramming software are updated as listed.

<b>i-HDS Software Version</b>	1.013.003 or later
<b>HDS Software Version</b>	3.105.036 or later
<b>Honda ECU Reprogramming</b>	4.10.0.0 or later

Update only the system(s) and software listed in this service bulletin.

<b>Year/Model</b>	<b>Trim</b>	<b>Vehicle System</b>	<b>Program ID (or later)</b>
2023-25 Accord	ALL	TCU	8B010-30A-A070

### NOTE:

- Make sure the 12-volt battery is fully charged before starting an update.
- Use only approved VCI devices outlined in Service Bulletin 22-100 *Updating Control Units/Modules with the ECU Reprogramming Application*.
- Warranty reimbursement for technician labor is not allowed for routine checking or installation of any available software update.
- This update will not require entering a service bulletin number.

## REPAIR PROCEDURE

1. Use Honda ECU Reprogramming to perform a software update on the TCU (also referred to as TSU).

### NOTE:

- For more information about updating vehicle systems, refer to service bulletin 22-100, *Updating Control Units/Modules with the ECU Reprogramming Application*.
- The update progress may appear to freeze for up to 20 min when installing an update. This is normal and will progress automatically.
- The TCU must be in version 8B010-30A-A060 to apply version 8B010-30A-A070. Previous updates may need to be applied before the current version can be applied, so multiple ignition cycles may be needed.
- Previous updates may need to be performed before proceeding with this update.