

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A6 e-tron, S6 e-tron, Q6 e-tron, Q6 Sportback e-tron, SQ6 e-tron, and SQ6 Sportback e-tron	2025	All	5P2 and without B29

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised <i>Condition</i> (Add vehicle specific equipment stipulations)
4	12/18/2025	Revised <i>Condition</i> (Added model table) Revised <i>Warranty</i> (Updated Labor Operations)
3	10/22/2025	Revised header (Add Control Unit)

Customer states:

- There are **no** rear occupants in the vehicle → a warning message appears, and the vehicle horn may sound, and its lights may flash.
- There **are** rear occupants in the vehicle → a warning message appears but the vehicle horn does **not** sound, and its lights do **not** flash.
- Possibly also interpreted as unintentional triggering of the anti-theft alarm.

Workshop findings:

- No event memory entries logged.
- In the event of a warning where the horn sounds and/or the lights flash: Anti-theft alarm system not triggered during period of complaint, e.g. can be reproduced via the measured value blocks of the anti-theft alarm system.

Technical Background

Issues may occur with the rear occupant detection (available since model year 2025). Due to these issues, the rear occupant detection may trigger warnings more, or less often.

Production Solution

Optimized software as of week 19/2025.

Service

This TSB replaces Pending Service Solution (PSS) TSB 2077108: 69 PSS Postpone repair: rear occupant detection / alarm "unintentional triggering of horn/flashing lights".

Please perform the update in TSB 2079690, 00 Combined software update 03.10.00/C (28.13.01) KD2.

Warranty

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9602		
Damage Code:	KD02		
Labor Operations:	Software update, including connecting battery charger	0151 0010	See SRT with associated operations
	Fixed rate for software update, including all required preliminary and follow-up work (including bus sleep cycle, calibration drives, and additional work)	0151 0040	130 TU
	In the case of additional attempts, an additional lump sum of 50 time units is possible per flash cancellation.	0150 9999	50 TU Per each documented attempt
Claim Comment:	As per TSB 2077961/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2077961**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.