



Service Bulletin

Bulletin No.: PIT6474A

Date: February, 2026

PRELIMINARY INFORMATION

Subject: Loss of Brake Assist Multiple Warning Messages and MILs with P0562 P0606 After Engine Start

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500 (RPO J22, VIN Digit 5 = A or D)	2022		All	All	All	All
Chevrolet	Silverado 1500	2023-2024		All	All	All	All
GMC	Sierra 1500 (RPO J22, VIN Digit 5 = H or U)	2022		All	All	All	All
GMC	Sierra 1500	2023-2024		All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment that after starting the engine, several warning messages and MILs are illuminated and there is a loss of brake assist. When checking for DTCs P0562 and P0606 will be set in the K160 Brake System Control module.
Cause	The cause of this concern is a drop in voltage below a predetermined threshold to the Brake System Control module during engine cranking (Push button start, Auto Start, RVS, Onstar, etc).

Correction

Dealers must clean and tighten all battery cable connections, test the battery and charging system following the published diagnostics in Service Information, and reprogram the K160 Brake System Control module with the latest software.

Version	2
Modified	01/21/2026 - Created on 02/27/2026 - Updated to remove KL9 stop/start identification, cause and correction sections.

