



## **SSM 54615 2020-2026 Escape, 2021-2026 Corsair - 2.5L - Fuel Door Will Not Open With DTC P04CA Stored In The PCM**

Some 2020-2026 Escape and 2021-2026 Corsair vehicles equipped with a 2.5L engine may exhibit a fuel door that won't open with diagnostic trouble code (DTC) P04CA stored in the powertrain control module (PCM). This may be due to an open circuit on circuit SBB05 and/or a damaged splice S133. Before performing the pinpoint test for P04CA in Workshop Manual (WSM), Section 310-00, inspect circuit SBB05 and splice S133 for damage such as an open circuit. Repair as necessary. Refer to Wiring Diagram, Cell 005. If no damage is found, refer to WSM, Section 310-00 for normal diagnostics. For claiming use causal 14290 and labor operations 12650D, 12650D45, and 12650D45WR.