

L634-
A.08.26

To: **After Sales Official Network**
Subject: **Rework on LH-RH door emergency release cover**
Date: **23/02/2026**
Pages **6**



Campaign code:
L634-A.08.26

Campaign name:
Rework on LH-RH door emergency release cover

Model:
Temerario (Only for vehicle with upholstery configuration)

Model Year:
2026

Markets:
Austria, Azerbaijan, Bahrain, Belgium, Brazil, Cambodia, Canada, Czech Republic, Denmark, Estonia, France, Georgia, Germany, Greece, Hong Kong, Hungary, India, Indonesia, Italy, Japan, Kuwait, Latvia, Lebanon, Macao, Malaysia, Mexico, Monaco, Netherlands, New Zealand, Norway, Oman, Philippines, Poland, Portugal, Qatar, Romania, Singapore, South Africa, Spain, Sweden, Switzerland, Taiwan, Thailand, Turkey, United Arab Emirates, United Kingdom, United States

VIN Involved:
Until Vin TLA00849


Important information: before proceeding with the repair, connect to the Warranty Portal and, using the “VIN Info” function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

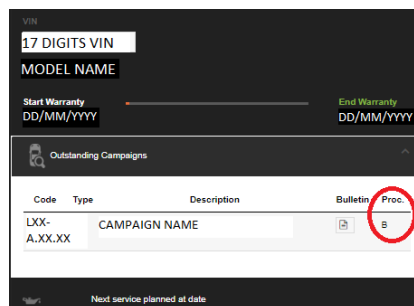

Information for the service network:

During continuous product monitoring, Automobili Lamborghini S.p.A. is asking to check and rework the door emergency release cover .

Solution for the field:

Following the inspection of the cover, it is required the application of felt pads as described in operations B and C.

Spare Parts:

None.

Management of replaced parts:

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.

Labor time:

Operation A: 0.1h
Operation B: 0.3h
Operation C: 0.3h

Previous bulletins superseded.


None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the “LIASS” system on the Lamborghini portal and, following the instructions in the system’s “Manuals” section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the



options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

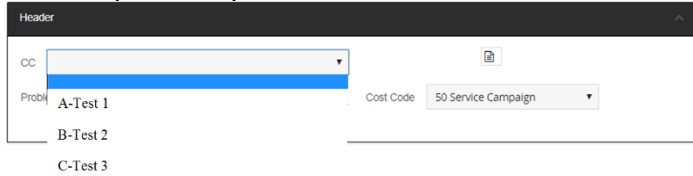

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPERATION A:**
 - o Steps to be executed: from 1 to 4
 - o Labour time: 0.1 h
- **OPERATION B:**
 - o Steps to be executed: from 5 to 13
 - o Labour time: 0.3 h
- **OPERATION C:**
 - o Steps to be executed: from 14 to 22
 - o Labour time: 0.3 h

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section “Service and Recall Campaigns”:

Tools/Materials required

Code	Description.	Q.ty
533867910A*	Felt strip	n\a

*The cost of the felt strip is included in the labor time.

Is possible to buy another commercial Felt strip with same technical data, according to DIN 61206, with thickness 1mm and width 20mm.



NOTE:

All ODIS technical documentation can be viewed on the Lamborghini web portal, in the ODIS section.





Preliminary operations:

OPERATION A

Follow the instructions below:

1. Check the door panel on the right and left sides.
2. Remove the emergency release cover (1) by pressing on the bottom corners and check that it detaches easily from the door panel.
3. If the emergency release cover (1) does not easily come off, perform **operation B**. If the emergency release cover (1) is removed smoothly, perform **operation C**.
4. When finished, check that the orange bowden cable strap is correctly secured to the cover and that the emergency release cover (1) is correctly positioned on the door panel.

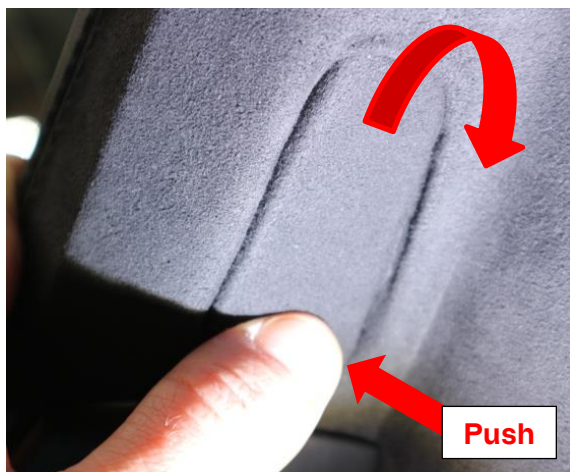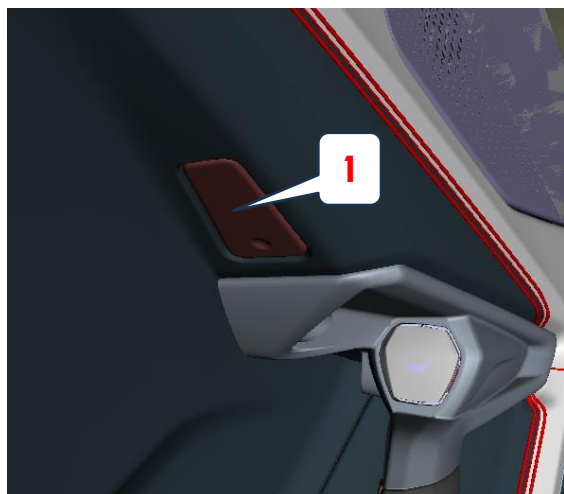

Repair method:

OPERATION B:

Follow the instructions below:

5. Once the emergency release cover (1) has been removed, clean the felt pad bonding area with ISP 1510 isopropanol.



6. *Based on the type of door panel finish:*

6.1. With "Dinamica" door panel finish:


Cut the felt pad code 533.867.910A into 3 pieces. Each piece should measure 20x20 mm. Stick the 3 felt pads together. This will create a packet.

6.2. With "Leather" door panel finish:

Cut the felt pad code 533.867.910A into 4 pieces. Each piece should measure 20x20 mm. Stick the 4 felt pads together. This will create a packet.



7. Wait 50 seconds for the felt pads to dry.

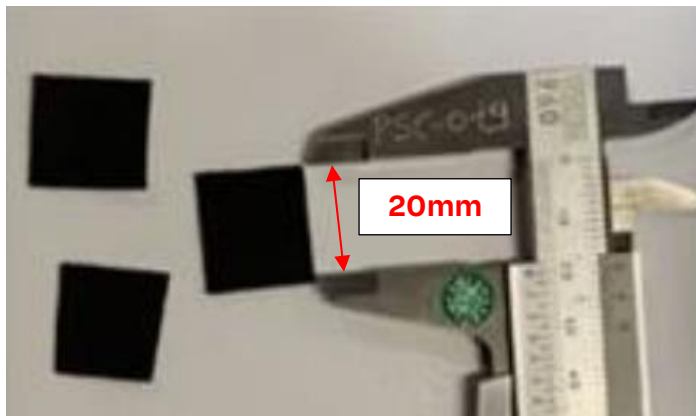

8. Apply the felt pads to the previously cleaned area.



9. Reinstall the emergency release cover (1) and test it for easy removal.
10. If functioning correctly, place the emergency release cover (1) in its place.
11. If it does not operate correctly, add another piece of felt (20x20 mm) and check the lid release again.
12. At the end of the procedure, check that the orange bowden cable strap is correctly attached to the emergency release cover (1).

13. Perform a visual inspection of the area where work has been carried out.

When you fill the campaign on Liass, specify in the "Corrective actions" field whether the not-OK side is driver side, passenger side, or both.



Repair method:

OPERATION C:

Follow the instructions below:

14. Once the emergency release cover (1) has been removed, clean the felt pad bonding area with ISP 1510 isopropanol.



15. Based on the type of door panel finish:

15.1. With "Dinamica" door panel finish:


Cut the felt pad code 533.867.910A into 3 pieces. Each piece should measure 20x20 mm. Stick the 3 felt pads together. This will create a packet.

15.2. With "Leather" door panel finish:

Cut the felt pad code 533.867.910A into 4 pieces. Each piece should measure 20x20 mm. Stick the 4 felt pads together. This will create a packet.

16. Wait 50 seconds for the felt pads to dry.

17. Apply the felt pads to the previously cleaned area.

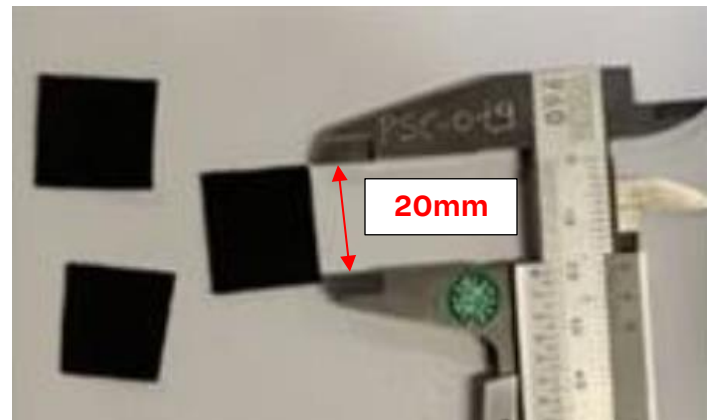

18. Reinstall the emergency release cover (1) and test it for easy removal.
19. If functioning correctly, place the emergency release cover (1) in its place.
20. If it does not operate correctly, add another piece of felt (20x20 mm) and check the lid release again.
21. At the end of the procedure, check that the orange bowden cable strap is correctly attached to the emergency release cover (1).
22. Perform a visual inspection of the area where work has been carried out.



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service