

## Technical product information

<b>Topic</b>	Front Passenger Airbag Indicator Lamp - Illuminated / Indicator Not Functioning
<b>Market area</b>	Bentley: worldwide (2WBE),China 796 VW Import Comp. Ltd (Vico), Beijing (6796)
<b>Brand</b>	Bentley
<b>Transaction No.</b>	2080902/1
<b>Level</b>	EH
<b>Status</b>	Released for publication
<b>Release date</b>	Feb 16 2026

### Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
0015 - Airbag	B101629: Front passenger airbag -disabled- indicator lamp implausible signal		static
0015 - Airbag	B12F129: Front passenger airbag -enabled- indicator lamp implausible signal		static
0015 - Airbag	B101629: Front passenger airbag -disabled- indicator lamp implausible signal		Intermittent
0015 - Airbag	B151329: Front passenger airbag indicator lamp, text illumination implausible signal		static
0015 - Airbag	B151329: Front passenger airbag indicator lamp, text illumination implausible signal		Intermittent
0015 - Airbag	B12F129: Front passenger airbag -enabled- indicator lamp implausible signal		Intermittent

### New customer code

Object of complaint	Complaint type	Position
information, navigation, communication, entertainment -> symbolic warning indicators -> airbag system warning display	functionality -> activates	

## Vehicle data

### Continental GT/GTC

#### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*

3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*
3S3*	2023	E		*	*	*
3S3*	2024	E		*	*	*
3S4*	2019	E		*	*	*
3S4*	2020	E		*	*	*
3S4*	2021	E		*	*	*
3S4*	2022	E		*	*	*
3S4*	2023	E		*	*	*
3S4*	2024	E		*	*	*

## Flying Spur

### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
ZG2*	2020	E		*	*	*
ZG2*	2021	E		*	*	*
ZG2*	2022	E		*	*	*
ZG2*	2023	E		*	*	*
ZG2*	2024	E		*	*	*

## Documents

<b>Document name</b>
<a href="#">master.xml</a>

## Customer statement / workshop findings

### Customer Statement

The customer reports that the airbag warning lamp is illuminated in the instrument cluster and the front passenger airbag indicator lamp within the roof console does not function.



**Figure 1.** Airbag warning illuminated in the instrument cluster

### Workshop Findings

Customer findings of airbag warning lamp illuminated in the instrument cluster verified in the workshop with the following DTCs stored in the airbag control module (address word 0015):

- B101629: Front passenger airbag - disabled- indicator lamp implausible signal – symptom code 9442857
- B12F129: Front passenger airbag -enabled- indicator lamp implausible signal – Symptom code 9629993
- B151329: Front Passenger airbag indicator lamp, text illumination implausible signal – symptom code 9769769

### Technical background

An implausible signal from the passenger airbag indicator is being reported to the airbag control unit. This behaviour is consistent with a connection or fitment issue at the roof console indicator module. A connection check and module fit inspection is required. Refer to the *Measure* section for the approved service action.

### Production change

Not applicable

## Measure



### CAUTION

Follow all ElsaPro airbag safety procedures. Incorrect handling can cause system faults or unintended deployment. Before disconnecting any connectors, switch off the ignition and allow control units to shut down.

1. Inspect the roof console module and ensure the housing is fully clipped together.  
Gaps or incomplete assembly may cause the indicator not to function.
2. Remove the front roof console module, check all electrical connectors at the roof console module.  
Refer to ElsaPro → Rep. Gr. 70 'Front roof console - To remove and fit'
3. Confirm terminals are fully seated, check for bent, recessed or damaged pins
4. Disconnect and reconnect the roof console module.
5. Clear DTCs and recheck operation.
6. If the warning lamps clear and the system functions normally, no further action is required.



### NOTICE

If faults persist or the indicator lamp remains inoperative, please raise a full technical DISS query and escalate it to second-level review by the Electrical TM for further guidance.



Include the following in the full technical DISS query:

- VIN, model, MY
- Customer Statement: "2080902 Support"
- Symptom description.
- Complete diagnostic logs.

## Warranty accounting instructions

Warranty type 110 or 910

Damage service number 96 20

Damage code 00 40

## Labour

### Time to remove and fit roof module

Labour Operation Code: 96 20 19 00

Time: 20 TU (Continental GT/GTC)

Time: 10 TU (Flying Spur)

### GFF Guided Functions

Labour operation code 01 50 00 00

Time 10 TU

## **Parts information**

No parts are required for the initial repair procedure.

If further action is advised through a DISS response, part numbers and replacement guidance will be provided by Bentley Technical Support.