



TECHNICAL SERVICE BULLETIN

Illuminated Powertrain Malfunction (Wrench) Indicator And/Or CSI And Hazard-Stop Safety Now Indicator Blinking Red With DTCs P27B4, P0A7F And/Or P0CF7

26-2096

06 March
2026

This bulletin supersedes 22-2495. Reason for update: revised symptoms in the TSB title and issue, and an update to labor times, changing from MT time to actual time with a limit.

Model:

Ford 2022 F-150	Lightning
---------------------------	-----------

Issue: Some of the vehicles listed in the Model statement above may exhibit at least one of the following conditions:

- Illuminated powertrain malfunction (wrench) indicator with DTC P27B4 stored in the SOBDMC
- CSI and hazard-stop safety now indicator blinking red with DTC P0A7F stored in the BECM and/or DTC P0CF7 stored in the SOBDM (also referred to as the [BCCM])

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to reprogram the SOBDM/ BCCM.

Warranty Status: Warranty coverage limits and policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

Labor Times

Description	Operation No.	Time
2022 F-150 Lightning: Reprogram The Appropriate Modules As Required By The Software Update And Service Procedure (Do Not Use With Any Other Labor Operations)	AP262096A	Actual Time Up To 1.5 Hours

Repair/Claim Coding

Causal Part:	10B689
Condition Code:	04

Service Procedure

1. Reprogram the PCM using the latest software level of the FDRS.
2. Follow the on-screen instructions to update all of the following modules as necessary:
 - SOBDM
 - BECM
 - SOBDMB
 - SOBDMC
 - ABS

NOTE: Only one module may be updated at a time.

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.