



SSM 54629 2021-2023 Bronco - Charging System Lamp Illuminated And/Or DTC B11DB:08 Stored In The BCM - Built On Or Before 13-Jun-2023

Some 2021-2023 Bronco vehicles may exhibit a charging system lamp that illuminates intermittently, and/or diagnostic trouble code (DTC) B11DB:08 in the body control module (BCM). This may be due to a loose fuse terminal for the low voltage high current fuse (3A). If this condition is present, compare fuse removal effort between the low voltage high current fuse and like fuses in the battery junction box (BCMC). If removal effort for the fuse is low, replace the low voltage high current fuse panel assembly to correct this condition. Refer to Workshop Manual (WSM) Section 414-01 > Removal and Installation > Low Voltage High Current Fuse. For claiming, use causal part 14526 and labor time MT14526SSM with a limit of 0.5 hours.