



## **SSM 54633 2023-2024 Bronco Sport - 1.5L - Illuminated Powertrain Malfunction (Wrench) Indicator With DTC P130D Stored In The Powertrain Control Module (PCM)**

Some 2023-2024 Bronco Sport vehicles equipped with a 1.5L engine may exhibit an illuminated powertrain malfunction (wrench) indicator with diagnostic trouble code (DTC) P130D stored in the PCM. This may be caused by poor quality fuel being used in the vehicle. As stated in the Owner's Manual under "FUEL QUALITY - Choosing the Right Fuel", use of any fuel for which the vehicle was not designed can impair the emission control system, cause loss of vehicle performance, and cause damage to the engine. Do not use: diesel fuel, fuels containing kerosene or paraffin, fuel containing more than 15% ethanol or E85 fuel, fuels containing methanol, fuels containing metallic-based additives, including manganese-based compound, fuels containing the octane booster additive, methylcyclopentadienyl manganese tricarbonyl (MMT) or leaded fuel. Using leaded fuel is prohibited by law. Make sure the fuel being used in the vehicle is from a reputable fueling station. If a vehicle exhibits this condition and fuel quality is suspected, recommend draining and cleaning the fuel system, and refilling the fuel tank with good quality fuel in accordance with Workshop Manual (WSM), Section 303-07A > Diagnosis and Testing > Pinpoint Test Step DG8.